AIRCRAFT TECHNICAL LOGS

Section 1. AIRFRAME

N: 593 ² Standard	5934PD-3 C/N: Alt Reading (Ft)	/N: A.130 Ft) Standard	S/N: 462838 Alt Reading (Ft)
Alt (Ft)	@ Room Temp	p Alt (Ft)	@ Room Temp
-1,000	-10	14,000	.30
	0	16,000	- 40
200	0	18,000	04-
1,000	+10	20,000	-20
1,500	+ 5	22,000	
2,000	+2<	25,000	
3,000	+15	30,000	
4,000	+15	35,000	
000,9	01+	40,000	
8,000	۲-	45,000	
10,000	'n	20,000	
12,000	-45	4	
10-S-07	Tested By:	3	Inspected By: (15)

AIRCRAFT

1.	Nationality and Registration	N654MS
2.	Manufacturer's Designation	DA 40
3.	Manufacturer's Serial Number	40.842
4.	Type Approval or Specification Number	A-224/A47CE
5.	Date of Manufacture	2007
6.	Aircraft Inspection Cycle	

	DA	ILY	TOTA	L AIR			
DATE	тот			SINCE FG.	ENGINEERING RECORD NOTE: USE BOTH PAGES AND AS MANY LINES AS REQUIRED FOR COMPLET	INSPECTION, REPAIRS & REPLACEMENT SIGNA NATRIES. DRAW A DIAGONAL LINE THROUGH ANY UNUSED LINES IN DATE AND TIME COLUMNS.	ATURE LICENCE
	HRS.	MIN.	HRS.	MIN.		ENTRIES. DRAW A DIAGONAL LINE THROUGH ANT UNUSED LINES IN DATE AND TIME COLUMNS.	NUMBER
BROUGHT FORWARD			ч,	4			2 (DA)
		4	Diam	end		Diamond	
		1			D AIRCRAFT INDUSTRIES INC.		
		1			ROVED MANUFACTURER #161-93	U.S. Standard Airworthiness Certificate, issued:	
					THAT THIS AIRCRAFT CONFORMS TO THE	CED 2 0 2007	
$\overline{}$		API	PROVED	TTPE DE	SIGN DATA AND IS IN A FIT AND SAFE STATE FOR FLIGHT.	(Date) SEP 2 0 2007, has been installed in the aircraft on behalf of NE-MIDO-46 on:	
			SE	DATE P 2 7 2	INSPECTOR DA Q 42	(Date) SEP 2 8 2007 (Print) R. Salton (Signature) (Signature) (Signature) (Date) Sep 2 8 2007 (Print) R. Salton (Signature) (Signature) Sep 2 8 2007 (Print) R. Salton (Signature) (Date) Delegate (Date) Delegate (Date) Delegate (Date) Delegate	
						Sign Dave Base State	
						N Number Date TACH/HOBBS AFTT 654MS 10/19/2007 22.7 22.7 AF Entry Performed 25 hour inspection on this aircraft by complying with 100 hour inspection items in accordance with Diamond Aircraft DA 40 AMM chapter 05-20-00. Checked all controls for proper rigging and lubrication. Checked all structural points, inspected all hoses, lines and wiring. Checked tires, wheels and brakes for condition. Replaced instrument air filters as required. Checked and serviced all fluid levels. Checked MFG SB's and applicable AD's for compliance to date. All work performed in accordance with Diamond Aircraft maintenance manual and standard practice as listed in FAR part 43 to return this aircraft to service in airworthy condition. Refer to WO# G01197 on file at Dillon's Aviation, Inc. Ladd J MaxSon, Jr A&P3064381 12/21/2007 N654MS s/n 40.842 Tach:96.7 TTAF:96.7 1. Jack aircraft, remove LMG tire and wheel assembly. Disassemble wheel, remove, clean and inspect wheel bearings. Repack wheel bearings with Mobil 28 grease. Install new tire and tube. Set tire pressure to 36 psi. Reinstall tire and wheel assembly, reinstall wheel fairing. I certify that the above captioned maintenance was performed in accordance with all applicable manufacturers' maintenance manuals, and other approved or acceptable data, as appropriate. Geoffrey E. Peterson, A&P 3236901	
-							
	-						
		A					
					CARRIED FORWARD		

INSPECTION, REPAIRS & REPLACEMENT TRIES, DRAW A DIAGONAL LINE THROUGH ANY UNUSED LINES IN DATE AND TIME COLUMNS. NNumber Date TACH/HOBBS AFTT N654MS 4/8/2008 220.0 220.0 AF Entry Performed 100 hour inspection on this aircraft in accordance with FAR 43 appendix D. Checked all controls for proper rigging and lubricated. Checked all cables for proper tension, checked all structural points, inspected all hoses, lines and wiring. Repacked all wheel bearings, checked tires, wheels and brakes for condition. Replaced RH brake pads with new PN 66-14100. Replaced overhead light lamp PN OSR2845. Inspected ELT in accordance with FAR 91.207(d) next due 04/2009, battery replacement date 11/2009. Replaced instrument air filters as required, checked and serviced all fluid levels, lubricated controls and washed aircraft. Checked MFG SB's to date. Checked applicable AD's for compliance to date. All work performed in accordance with Diamond service manual and standard practice as listed in FAR part 43 to return this aircraft to service in airworthy condition. Refer to WO#G01341 on file at Dillon's Aviation, Inc. AD 2007-17-06 Nose Gear Inspection not due until 321.2 or 01/09 whichever occurs later,	LICEN
Performed 100 hour inspection on this aircraft in accordance with FAR 43 appendix D. Checked all controls for proper rigging and lubricated. Checked all cables for proper tension, checked all structural points, inspected all hoses, lines and wiring. Repacked all wheel bearings, checked tires, wheels and brakes for condition. Replaced RH brake pads with new PN 66-14100. Replaced overhead light lamp PN OSR2845. Inspected ELT in accordance with FAR 91.207(d) next due 04/2009, battery replacement date 11/2009. Replaced instrument air filters as required, checked and serviced all fluid levels, lubricated controls and washed aircraft. Checked MFG SB's to date. Checked applicable AD's for compliance to date. All work performed in accordance with Diamond service manual and standard practice as listed in FAR part 43 to return this aircraft to service in airworthy condition. Refer to WO#G01341 on file at Dillon's Aviation, Inc. AD 2007-17-06 Nose Gear Inspection not due until 321.2 or 01/09 whichever occurs later.	
Shay Powers For Dillon's Aviation, Inc. AP3219912	
N Number N654MS Date TACH/HOBBS 4/8/2008 220.0 Log Entry Upgraded G1000 software to Phase 6 software version 0369.13 -2 configuration PN 010-00369.13 in accordance with STC #SA0144WI-D, Garmin SB0739 Revision B and Diamond DA40 & DA40F field update instructions PN 190-00544-03. Installed revised documents in aircraft Cockpit Reference Guide and Flight Manual Supplements. Installed new TAWS unlock card PN 010- 00330-51 for system ID change during software update. Refer to WO #G01341 on file at Dillon's Aviation, Inc. Hall Masker? Ladd J. Maxson, Jr. For Dillon's Aviation, Inc. AP3064381	
N Number N654MS Date TACH/HOBBS 5/15/2008 266.6 Log Entry Installed new aft cabin door handle assembly PN D41-5211-60-00-2. Refer to WO#G01375 on file at Dillon's Aviation, Inc. Hallf Masson, Jr. For Dillon's Aviation, Inc. AP3064381	
	Number N654MS **Date** TACH/HOBBS** 4/8/2008 220.0 **Log Entry** Upgraded G1000 software to Phase 6 software version 0369.13 -2 configuration PN 010-00369.13 in accordance with STC #SA0144WI-D, Garmin SB0739 Revision B and Diamond DA40 & DA40F field update instructions PN 190-00544-03. Installed revised documents in aircraft Cockpit Reference Guide and Flight Manual Supplements. Installed new TAWS unlock card PN 010-00330-51 for system ID change during software update. Refer to WO #G01341 on file at Dillon's Aviation, Inc. **Judich Major Ladd J. Maxson, Jr. For Dillon's Aviation, Inc.** **Number** N654MS** **Date** TACH/HOBBS** 5/115/2008 266.6 **Log Entry** Installed new aft cabin door handle assembly PN D41-5211-60-00-2. Refer to WO#G01375 on file at Dillon's Aviation, Inc. **Ladd J. Maxson, Jr. For Dillon's Aviation, Inc.** **Ladd J. Maxson, Jr. For Dillon's Aviation, Inc.**

DATE	DAILY TOTAL		TOT A	L AIR SINCE FG.	ENGINEERING RECORD	INSPECTION, REPAIRS & REPLACEMENT SIGN	SIGNATURE	LICENC
DATE	HRS.	MIN.		MIN.	NOTE: USE BOTH PAGES AND AS MANY LINES AS REQUIRED FOR COMPLET	NTRIES. DRAW A DIAGONAL LINE THROUGH ANY UNUSED LINES IN DATE AND TIME COLUMNS.		NUMBE
BROUGHT					Replaced Lett Marn Tike all Tube			
6/3/08	324	1.7			with New Remotalled on AIRCRAFT			
					Ops Check OK/			
			NA V		William / 2960804			
1/1/08	33/	9	,		Replaced RT. d. LT Main Tiles with	New 15 X6.0-6 Tires and Replaced Tubes		
					WiTh New G-15/6.00-6 Replaced	Right at Left BRake Pads with New, Replace a	all Spark Dlags.	Fine L
					OPS Check O.15.	Night I	1 10	,,,,,,,
					The state of the s	William Kulan A+8 2960804		
8/12/08	407	5			Removal Nose whool Faring and	Revisal WI al Bal.		
0110708					adj. for new Weight balance,	XCV/16m / 1 1 1 1 1 2960804		
8/20/08	41	7.3			Annual prevoluded See entry on	apples Remark upper at Lower eng Contry &	Remodulal	
				-	DThere side of This page	Jock Bat AFTER Servery: ResusTallal upper	e of horner Co	al.
	-					G/21/08 Remark uppor at Lower one Couling of Jack 3 Bot Aftar Services: Resustabled upper 1 1 of 585.0 GPS Check. O.K Andrew Johnson 313	300A2 C # 20/09	
		45.47.50	+ -	*		Hom 585.		
		654MS h time 4			Date 9/02/08			
_	1 ac	ii tiiiic -	T <i>L 1</i>		Bate 9102100	9/22/08 Hobs Inspected work preformed By	Andy Johnson	2
						11.15	nd Famel IT	7.5
	***	1 C	1			To be SutreficeTry		
— v y	Wo	rk prefo	ormea:			William Kuthan 14+1 2960 804		
	Ren	noved o	old stall	warnin	thorn and installed new warning horn. Ops check ok	The second of th		
	1,	r M.	1/1) H	A+1 2960804			
	ω	Muse	/_\)	usu	160007		N.	
		N#6541	MS me440.1		Date 09/16/08			-
	-							
	V	Work p Remov	red fuel b	a: oost pum aks noted	p SN#6515 Pn#5100-00-9 and replaced with new boost pump SN#8337. Ops at this time.			
	- 2	- /	11/		A+1 2960804			-
	-	W	Mon	150	111 2160001			
	Hobs				Coul upper at Lower To Acres Bat.			
9/20/08	585.	.b	Remo	evel	Bat. FOR Service, Bat UT how			-
	Trek		Do	To	Man Left ON. Reinstalled Eng Cowl FRARRIED FORWARD Adrew June 3130892 CRIO8/09			
	444.	.5	To 9	ROTEC?	FRARRIED FORWARD. ALL OL 3120202 CRIDE 109			
	-	1			pine discording			

DAIL V TOTAL AIR	TE I			
Diamond ANYONE FT	OLLOIS POR COMPLET	Tidewater Flight Center. 1777 West Road Chesapeake, VA 23323 757-319-4973 www.tidewaterflightcenter.com Removed Right and Left main tires and replaced with new 15x6.0-6 tires, cleaned and repacked wheel ops check OK	JRE	LICENC
N Number		Certificate number 2960804 Date 05/13/2009		+
654MS Date TACH/HOBBS				
1/9/2009 505.2 Log Entry		Tach time 605.0	-	
Installed exchange GIA63 LRU P/N 011-00781-01 S/N 48105049 and tested. C/W Diamond MSB 40-060 Wing Skin to spar bond. LH & RH		- Volumen results MA		
per W1-MSB-40-060. Filed void map with DAI and attached copy to	wing page			
maintenance records. Refer to WO# G01540 on file at Dillon;s Aviation, Inc.				
Saldf Marko For Dillon's Aviation, Inc.		HODITON		
AP3064381		AVIATION SERVICES		
		DATE6-08-09		_
Tidewater Flight Center. 1777 West Road Chesapeake, VA 23323		Internally timed		
Chesapeake, VA 13325 Firsth: 177-319-4973 www.tidewaterflightcenter.com		Internally timed magneto P/N 4370 S/N 03091887 I.A.W Manufactures instructions and the second secon		
On the date a 100 hour inspection I/AW FAR 43 Appendix D checklist was preformed.	or	Manufactures instructions, op check is required after installation, all secure		
Description of work performed, Drained to Figure 2015 and Control surfaces and checked cable tensions, checked	d - 4			
Cyl PSI. Cyl #1 78/80 #2 78/80 #3 74/80	4.8 T N	Robert J. McLaurin A&P3106325		_
injectors. Researched aliapplicable AD's through 2009-11. Comilied with AD# 2007-17-06 Notes and aliapplicable aD's through 2009-11. Comilied with AD# 2007-17-06 Notes and aliapplicable and the injection servo plug next due tach 568.7 AD# 2008-14-07 fuel injection tach 718.7 or 01/20/2010 AD# 2008-08-14 fuel injection servo plug next due tach 568.7 AD# 2008-14-07 fuel injection tach 718.7 or 01/20/2010 AD# 2008-08-14 fuel injection servo plug next due tach 568.7 AD# 2008-14-07 fuel injection tach 718.7 or 01/20/2010 AD# 2008-08-14 fuel injection servo plug next due tach 568.7 AD# 2008-14-07 fuel injection tach 718.7 or 01/20/2010 AD# 2008-08-14 fuel injection servo plug next due tach 568.7 AD# 2008-14-07 fuel injection tach 718.7 or 01/20/2010 AD# 2008-08-14 fuel injection servo plug next due tach 568.7 AD# 2008-14-07 fuel injection tach 718.7 or 01/20/2010 AD# 2008-08-14 fuel injection servo plug next due tach 568.7 AD# 2008-14-07 fuel injection tach 718.7 or 01/20/2010 AD# 2008-08-14 fuel injection tach 718.7 or 01/20/2010 AD# 2008-14-07	De la companya del companya de la companya del companya de la comp	Ret 07 -		_
Certificatenumber 2960804 Date 01/20/2009		Tidewater Flight Center. 1777 West Road		+
Tach time 518.7		Tidero ter 1777 West Road Flight Chesapeake, VA 23323 757-319-4973 www.tidewaterflightcenter.com	-	
William Adp Total time 518.37		Make: ACK Serial:059041	-	
Tidewater Flight Center.		N#: _654MS	· -	
Tidewater Flight Center. 1777 West Road Flight Chesapeake, VA 23323 TST-319-4973 www.tidewaterflightcenter.com		I have inspected the Make/Model/Serial Number ACK / E-01 /059041 ELT system in this aircraft applicable Aircraft and ELT manufacturer's interactions and applicable FAA guidance and found requirement's of FAR 91.207 (d). The ELT battery expires on 03/2013	t according to hat it meets the	
***************************************		Signed: Certificate Number:	- [
Make: _ACK Serial:059041 N#: _654MS		Date:		
I have inspected the Make/Model/Serial Number ACK / E-01 /059041 ELT system in this aircraft according to applicable Aircraft and ELT manufacturer's interactions and applicable FAA guidance and found that it meets the requirement's of FAR 91.207 (d). The ELT battery expires on June 19 2009 63 (2013		Certificatenumber 2960804 Date 06/08/2009 Signature Library Laboratory Date 06/08/2009		
signed: Clarificate Number: 2960804		Signature College Suffact time 618,3		_
Date: 2760 804		Tidewater Flight Center.		_
<i>San. 29. 2009</i> Certificatenumber Date 10/20/2009		Tides Atter 1777 West Road Tides Atter 1777 West Road Chesapeake, VA 23323 Flight 157-319-4973 Carager www.tidewaterflightcenter.com	3 	
Signature Tach time 518.8 Total time 518.7			===	
		On this date a 100 hour inspection I/AW FAR 43 Appendix D checklist was preformed. Description of work performed; Drained and replaced oil with Phillips 20w50, removed oil filter cut or any discrepancies and installed new 48110-1 filter, lubricated all control surfaces and checked cable.	terisions, dileuked	
		Cyl PSI. Cyl #1 78/80 #2 68/80 #3 70/80 #4 68/80, removed- cleaned-gapped and reinstalled all Removed right mag and replaced with new mag PN#4370 SN# 03091887 IAW manual, installed new flange PN#3802-0022,D417166-20-31,30,33,42, Researched allapplicable AD's through 2009-11. Co	spark plugs, alt air duct and	-
		1lange PN#3802-0022,D417166-20-31,30,33,42, Researched aliapplicable AD's tillough 2009-11. 00 02-03 by I 1-10 and K - M Icertify that this aircraft has been inspected I/AW 100hr inspection and has in an airworthy condition and has been approved for return to service.	es been found to be	
	A. C.	Continue 29/2 204 Date 06/09/00	_	+
		Signature Signature Add Ruthur	-	
CARRIED FORWARD		Willia Cutter Ad 8	· -	

41)

	DAI		TOTAL	AIR	ENGINEERING RECORD	INSPECTION, REPAIRS & REPLACEMENT SIGNATURE LICENCE
DATE	HRS.	MIN.	HRS.	MIN.	NOTE: USE BOTH PAGES AND AS MANY LINES AS REQUIRED FO	OR COMPLET ENTRIES. DRAW A DIAGONAL LINE THROUGH ANY UNUSED LINES IN DATE AND TIME COLUMNS.
ROUGHT	HHS.	MIN.				Tidewater Flight Center. 1777 West Road Flight N654MS Chesapeake, VA 23323 757-319-4973 www.bidewaterflightcenter.com
N Number N654MS Date 8/14/2009 Log Entry Installed n	TACH 67 1	и/новвs 2 root sea		nd RH w	ings P/N B6000676. Installed new r to WO# G01730 on file at Dillon's	Replaced left brake caliper 'O" ring seal with new PN# MS28775-224 bled brake of air and fill brake res. Replaced brake linings on right main gear with new PN# 66-106, Removed left main tire from aircraft and replaced with new 15x6.00-6 tire and reinstalled on aircraft. Ops Check OK Certificatenumber ADE 1331 DM Date 01/21/2010 Signature GR Fayrance Tach time 754.0 TTach 754.0
Aviation II Ladd J Ma AP306438 Tidespase Flight Camea On thisdate a 10 Description of wany discrepance Cyl PSI. Cyl #1 Replaced rights	axson Jr. hour insperies and installing from the former f	ction TJAW d. Drained a sed new 481 3/80 #3 76/and outer b	Tidewalt 1777 Chesape 1757 www.tidewal 1757 www.tidewal 1757 www.tidewal 1757 1757 1757 1757 1757 1757 1757 175	r Flight Center West Road gake, VA 23323 -319-4973 retrlightcenter. 1954MS Indix D check il with Phillip iscated all co femoved- cl pn#066-14 -11. Comliec	list was preformed s 20w50 , removed oil filter out open and checked for introl surfaces and checked cable tensions, checked paned-gapped and reinstalled all spark plugs 00, Removed, cleand and reinstalled all 4 fuel with AD# 2007-17-06 Nose landing gear next due	Shelby Performance Aviation 32446 John B. Rose Drive Franklin Va. 23851 CRS 2SB016B The static system, altimeter instrument and automatic altitude reporting system tests required by 14 CFR Part 91.411 have been performed and found to complywith 14 CFR Part 43 appendix E. The altimeter was tested to N 654M5 Tach/Hobbs 704.
tach 788.2 of us been inspected for return to sen Certificatenumb Signature	PANY ANNOUNCE PROPERTY	AL IIISPECIA	DUI.A. Tidow 11 Ches		2009 8 2 888. 2 Inter.	Signed: Sleft Inspector Shelby Performance Aviation CRS 2SBR016B Date: 7/29/09
Make:ACK N#: _654MS	ed the ACK interactions or expires on	erial:055 - E-01 -055 s and application 03/2013 - Certi	0041 - ELT sy able FAA guid ficate Numbe	stem in this	aircraft according to applicable Aircraft and ELT und that it mosts the requirement's of FAR 91.207 (d)	Shelby Performance Aviation 32446 John B. Rose Drive Franklin Va. 23851 CRS 25B016B 14 CFR Part 43 appendix F. #2 S/N #2 S/N Signed:
8					CA IEO FORINA	Date of Shelby Performance Aviation CRS 2SBR016B

SECTION: VATE: 08-10-07

DATE	DAILY TOTAL	TIME	AL AIR E SINCE AFG.	ENGINEERING RECORD NOTE: USE BOTH PAGES AND AS MANY LINES AS REQUIRED FOR COMP	INSPECTION, REPAIRS & REPLACEMENT OF TRIES, DRAW A DIAGONAL LINE THROUGH ANY UNUSED LINES IN DATE AND TIME COLUMNS.	SIGNATU
BROUGHT FORWARD	HRS. MIN	. HRS.	MIN.		Tidewater Flight Center. 1777 West Road Flight N654MS Chesapeake, VA 23323 757-319-4973	
	TACH/HOBI 674.2		, a DII	usings P/N 86000676 Installed new	Replaced left brake caliper 'O" ring seal with new PN# MS28775-224 bled brake of air and fill brake res. Replaced brake linings on right main gear with new PN# 66-106, Removed left main tire from aircraft and replaced with new 15x6.00-6 tire and reinstalled on aircraft. Ops Check OK Certificatenumber Abb 1331/DH Date 01/21/2010 Signature Tach time 754.0 TTach 754.0	/ -
Installed new up flap indical Aviation Inc. Ladd J Maxso AP3064381	tor light P/N	eal on LH RC0810	717. Ref	wings P/N B6000676. Installed new er to WO# G01730 on file at Dillon's	Shelby Performance Aviation 32446 John B. Rose Drive Franklin Va. 23851	
any discrepancies and Cyl PSI. Cyl #1 76/8/ Replaced right and let injectors, Researched	d installed new 4 0 #2 78/80 #3 ft inner and outer I allapplicable AD	Www.tide W FAR 43 Appl d and replace in 110-1 filter. In 16/180 #4 76/8 brake pabs wis through 200	ionicated all 60, removed- with pn#066-1	23	The static system, altimeter instrument and automatic altitude reporting system tests required by 91,411 have been performed and found to comply with 14 CFR Part 43 appendix E. The altimeter was N 654/M5 Tach/Hobbs 704.	14 CFR Partested to
Certificatenumber A	1 Se 1331	1041.A	Tach time (588.2 688.2	Signed: Signed: Inspector Shelby Performance Aviation CRS 2SBR016B	
Tidevater Flight Contor	Org	Ch	ewater Flight C 1777 West Roa esapeake, VA 757-319-4973 idewaterflightco	d 23323		
Make: ACK N#: 654MS I have inspected the manufacturer's intera The ELT battery exp Signed: Control Date: Certificatenumber Signature	actions and appl ires on 03/2013	59041 - ELT s icable FAA gu	idance and f	· · · · · · · · · · · · · · · · · · ·	Shelby Performance Aviation 32446 John B. Rose Drive Franklin Va. 23851 CRS 2SB016B The ATC transponder test required by 14CFR Part 91.413 has been performed and found to comply with 14 CFR Part 43 appendix F. #1 S/N <u>BS9104478</u> #2 S/N W/O #	
Signature					N_639713 TACH/HOBBS_704-1	
2				CA' LED FORWA'	Inspector Shelby Performance Aviation CRS 2SBR016B Date: 9/29/09	

AD

DATE	Tidewater Flight Center. 1777 West Road Filight Center. 1777 West Road Chesapeake, VA 23323 757-319-4943 www.tidewaterflightcenter.com	R COMPLET Tidewater Filight Center. 1777 West Road Chesapeake, VA 23323 757-319-4973 www.tidewaterflightcenter.com	URE LICEN	
JGHT ARD	Performed a 100 hr inspection on this airframe IAW FAR 43 appendix D.Replaced right main tire. Stop drilled small crack in right wheel fairing. Replaced three rivets in right wheel fairing mount. Repllaced damaged screws in right seat pan. Lubercated all plate nuts for inspection panels. Removed damaged #4 EGT probe system released under FAR 91-213, placards installed as required. Lubercated all flight controls. All ADs checked through 2/19/2010 Ran aircraft all systems check ok, aircraft returned to service. Ed Caapone A&E 1331104 Tach.771.6 Date 2/19/2010	Tach.778.8 Date march 16 2010 Bolt missing from right gear fairing, replaced bolt checks ok for service. William Rickard A&P 2960804 05 May '10		
	Tidewater Flight Center. 1777 West Road Flight Center N654MS Tidewater Flight Center. 1777 West Road Chesapeake, VA 23323 757-319-4973 www.tidewaterflightcenter.com	Diamond Supplement	<u> </u>	
	I have inspected the Make ACK Model ELT-200 Serial Number E059041 ELT system in this aircraft according to applicable Aircraft and ELT manufacturer's interactions and applicable FAA guidance and found that it meets the requirement's of FAR 91.207 (d). The ELT battery expires on March 2013 Signed: Certificate Number Ahi 331104 2013	N Number N654MS Date TACH/HOBBS 6/3/2010 851.5 Log Entry Removed old fuel pump. Installed newly repaired fuel pump PN 5100-00-09 SI 9821A, see Dukes Inc. 8130-3 Form. Leak and ops checked good. Installed EGT probe assembly PN A002BG-WIP in #4 position, ops checked good. Refer to WO#G01948A on file at Dillon's Aviation, Inc. Ladd J Maxson, Jr. For Dillon's Aviation, Inc. AP3064381	V	
	Tidewater Flight Center LLC. 1777 West Rd. Chesapeake,VA. 23323 N654MS Tach.917.0 Date 9/18/2009	Tidewater Flight Center. Tidewater Flight Center. 1777 West Road Flight Chesapeake, VA 23223 757-319-4973 www.tidewaterflightcenter.com		
?	Replaced emergency instruments battery, p n D60-2560-91-00 experation date April 2018, all ststems check ok. Ed Capone A&E 1331104 ——————————————————————————————————	Tach.871.2 Date 6/23/2010 Annual Inspection /Performed a 100 hr. inspection on this aircraft I.A.W. FAR 43 appendix D, and the Diamond maintenance manual Rotated both main tires cleaned and lubercated all wheel bearings. Lubercated all flight controls. Removed the rudder properties of the M/M and inspected as required. Removed and cleaned the main fuel filter. Cheked the wing fuel drains, no water found. Inspected the ELT per FAR 91-207Dmod. ACK-E-01 # 059041 Batt. due 3/2013. Serviced brake fluid. Inspected he nose landing gear leg as required, due at Tach. 1071.2 Performed AD 2009/10/4 inspection of nose gear ok All AD notes checked through 6/23/2010. Ran the aircraft all systems check ok for service. Ed Cappiny A&E 1331104 I certify that this aircraft has been inspected in accordance with the annual inspection and has been determined to be airworthy Ed Cappine A&E 1331104 I.A.		
	Tidewater Flight Center. 1777 West Road Fligh: Chesapeake, VA 23323 757-319-4973 www.tidewaterflightcenter.com	Ellapane		
	Tach. 803.0 Date 4/7/10 Brakes leaking fluid, installed new "O" ring seals in both brakes, installed four new brake pads, bled the brake system, ground check ok. William Rickrd A&P 2960804	Tidewater Flight Center. 2802 Airport Drive, Suite 1 Chesapeake, Virgina 23323 757-319-4973 www.tidewaterflightcenter.com Tach.835.3 Date 5/25/2010 Replaced stall warning horn,checks ok for service. Ed capone A&E 1331104 CALGUNINI		_

DATE	DAILY TOTAL AIR TOTAL TIME SINCE MFG. NOTE: USE BOTH PAGES AND AS MANY LINES AS REQUIRED FOR COMPLETED.	Tidewater Flight Center. 2802 Airport Drive, Suite 1	LICENCE
BROUGHT	HRS. MIN. HRS. MIN. Tidewater Flight Center. 2802 Airport Drive, Suite 1 2802 Airport	Tidewater Flight Center. Towards Towa	LICENCE
LOB BOOK ENTRY LOB BOOK ENTRY REPLICATION REPLICATION	Tach: 1472.4 Date: 29 July 2010 Remove ELT from aircraft, disassemble, remove unservicable battery pack, install new battery pack P/N: 452-3063, expration date of April/2012, reseal ELT cover, perform frequency test and impact test, test good, reinstall ELT into aircraft, perform test with instrument panel switch, test good. All work is in accordance with the Manufactures Maintenance Manual and this aircraft is return to service only for the work preformed. Pete Legarski A&P3429364 Pete Legarski A&P3429364	Tach reads: 972.1 Complied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Installed new LH and RH brake discs and linings. Repacked RH brake caliper and bled brakes. Installed new tube in RH wheel assy. Closed all panels. Repaired nose wheel fairing. Placarded AFCS system as inoperative. Ground run and leak check OK. I certify that this aircraft has been inspected in accordance with a 100 hour inspection was found to be airworthy. William Rickard AP 2960804 William Rickard AP 2960804	
	Tidewater Flight Center. 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 T57-319-4973 www.tidewaterflightcenter.com Tach: 904.0 Date 7/28/2010 Retrived aircraft from taxi way B.Replaced left main wheel tire and tube.Inspected area for any damage none found.Cleaned and inspected the wheel bearings.lubercated as required taxi aircraft all systems check ok for service. Ed Capone A&E 1331104	N Number N654MS Date TACH/HOBBS 11/11/2010 1009.8 Log Entry Updated G1000 NAVDATA Cycle 1011 Cycle Date 2010-Oct-21. Adjusted elevator trim friction from 1lb to 6.5lb in accordance with Diamond Aircraft AMM 27-38-00 (c). Refer to WO#G02047 on file at Dillon's Aviation, Inc. Ladd J Maxson, Jr. For Dillon's Aviation, Inc. AP3064381IA	
	Tidewater Flight Center. 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-319-4973 www.tidewaterflightcenter.com Tach: 904.0 Date: 29 July 2010 Remove R/S & L/S wheel assemblies, disassemble, clean, inspect for discrepancies, repack bearings with new grease, install two each 15X6.00 6ply tires, install R/S & L/S wheel assemblies on main gear, inspection revieled unsecure nut plate L/S axle hub, in addition to four unservicable break linings, secured nut plate with new fastners, replaced brakes with new linings P/N;066-14100, all work performed according to Manufactures Maintenance Manual and this aircraft is found to be returned to service only for the work performed. Pete Legarski A&P3429364	Tidewater Flight Center. 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 Ti57-319-4973 www.tidewaterflightcenter.com Date: 1/21/2011 AD 2009-10-04 does not apply Nose landing gear leg p/n D41-3223-10-00-1 is installed in in aircraft. See Diamond Service Bulliten MSB40-046/3 for aircraft serial number effectivity. Complied with AD 2010-25-01by incorporating Diamond Aircraft Temporary Revision TR-MÄM 40-428, page 3-37b, dated April 30, 2010 NO FURTHER ACTION REQUIRED James E Parkman/AP 3270184 IA	

CARRIED FORWARD

								Date June 1, 2011 Hobbs 1475.5 Make & Model Diamond DA40 N654MS	* .
	DATE		TAL	TIME	AL AIR SINCE FG.		Troubleshooting auto-pilot roll failure. Found 28vdc auto-pilot disconnect & the TAS600 remote mute shorted to ground under the G1000 LRU rack. Repaired wiring & connected the opening for wire routing. Reloaded system software for the G1000. SIGNATURE		
_		HRS.	MIN.	HRS.	MIN.	NOTE: USE BOTH PAGES AND AS MANY LINES	S AS REQUIRED FOR COMPLET	Auto-pilot still failing preffight test. Suspected the GRS77 is at fault. Removed the	LICENC
	BROUGHT	24	4	Tidewa	nter Filaht Cent	er.		Now the GIA #1 is failing software load. Swapped GIA's. GIA #2 now fails	
-	Tidowater Flight			Chesape	nter Flight Cent port Drive, Suit ake, Virginia 2: 57-319-4973	1 N654MS		Garmin. Loaded system software version 321.22 GDL69 now fatting software load.	
	Cautan	7			raterflightcente			Removed GDL69 and simple to the control of the cont	
	Tach: 1072.5				Dat	re: 1-21-2011 100 Hr		Courts for Evolvange or repair Received GIA63, AHRS &GDL69 from Garmin and	
	Performed a 100	0 hour ins	spection o	n this aircr	aft in acco	ordance with the Diamond M/M.Cleaned and		reloaded software. Auto-pilot now hauling trim problems. Repaired broken wires at manual electric trim switch. Ground checks & flight checks good.	
	adjusted the elevator trim drag system. Repaired the nose wheel pant cleaned and made a fiber glass repair to both halfs, installed a new latch for the right					ine mounts. Installed a new latch for the right		This aircraft found to be airworthy with respect to the work performed under	
9 2	side window.Replaced a worn brake pad on the anvil of the right brake.Replaced an 18" section of cooling baffle seal on the left rear baffle.Adjusted the elevator trim wheel friction per the M/M Replaced.				ed the elev	ator trim wheel friction per the M/M Replaced		Work order #23167.	
_	a nut plate on t	he right with the control	vheel pan Is per the	t mount, al M/M.Ran t	so one on the aircraft	the left wheel pant mount.Lubercated the		Signed & Mull	
7 —)	the nose wheel o	castor tens	sion per th	ne M/M.Che	ecked all A	Ds through 1/21/2011 Ran aircraft all systems		Inspector Bay Avionics, Ltd, CRS# HM1R197K	
·	Ed Capone A&E	1331104	Gell	0100	44	eu. _		Day Triomes, Eva, Ones Third Trion	
·			10	1				Tidewater Flight Center. 2802 Airport Drive, Suite 1	
07								F14.572 Criesapeake, Virginia 23323 N654MS	
-									
								AFTT 1172.5 Prop TT 0.00 Date: 7/7/2011	
	192							Installed Hartzell propeller model number HC-C2YR-1BFP/F7497 serial number NS392B on N654MS in accordance with Hartzell STC SA02476CH-D and installation instructions INST_102706. Propeller	
								installed with new o-ring. Tracked prop. Ground run OK. Installed FLight Manual Supplement AFMS_102706 dated 10/27/06 in arcraft Flight Manual. See FAA Form 337 this date.	
					¥			James E.Parkman AP3270184IA	
					11			1301	
				1,0	300			- Clartena -	
				1					
								Tidewater Flight Center. 2802 Airport Drive, Suite 1 Flights Chesapeake, Virginia 23323	
								757-319-4973 www.tidewaterflightcenter.com	
								Tach reads: 1172.5 Tach reads: 1172.5	
-								Complied with an ANNUAL inspection in accordance with FAR 43 appd D. Opened all panels.	
_			-	 					
	/							No defects noted. Battery due 3-2013. Installed new Goodyear Flight Custom II 15x6.00 tire on LH side. Rotated RH tire for wear. Set nose wheel castering force. Installed new lamp in flap indicator.	
_				ļ				Ground run and leak check OK. I certify that this aircraft has been inspected in accordance with an ANNUAL inspection was found to be airworthy.	
03	-04-11	1463.3				Date <u>March 4, 2011</u> Hobbs <u>1468.3</u> Make & Model	Diamond DA40 N654MS	Ed Capone A&E1331104 A	
_				-		Updated G1000 Main software to version to 321.	22. Troublechet auto pilot	- Col Conune	
-						fail to trim switch wire tension. Corrected AFCS check	ks good.		
_						This aircraft found to be airworthy with respect to the	work performed under		
-						Work order #23064.			
						Signed A / Mull	79.		
						Bay Avionics, Ltd, CRS# HM	MIR197K		
							. 7		

EDIY W
AVIATION
201211010

Ed Capone A&E 1331104IA

Tach reads: 1424.1

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

Removed wheel fairing. Removed caliper assembly. Cleaned and repacked caliper assembly as required. Bled brakes in accordance with the Diamond DA40 maintenance manual. Reinstalled wheel fairings

N654MS

Date: 3-6-2012

LICENCE TURE NUMBER

BROUG

Flight Conser

AFTT: 1273.3

1419334388

Tidewater Flight Center. 2802 Airport Drive, Suite 1 sapeake, Virginia 23323 757-319-4973

N654MS

HRED FOR COMPLET

Date: 9/23/2011

N654MS

Date 11/23/2011

p/n RG-24-15M

corde

Removed and

AFTT1353.0 battery

Complied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Closed all panels. Installed new LH and RH linings. Installed new RH tire with new. Installed new recapped nose tire. Rotated LH main tire on wheel. I certify that this aircraft has been inspected in accordance with a 100 hour inspection was found to be airworthy.

Wayne C. Newton AP3450425 IA

Diamond DA-40 N654MS
2

Found GDC 74 altitude out of tolerance. Removed GDC 74, part #011-00882-00 serial #47808070 to shop. Performed field calibration in accordance with Garmin manual #190-00303-82, dated February 2011 Rev. C. Returned to aircraft. See certification entry this date.

This aircraft found to be airworthy with respect to the work performed under Work order #23379.

Bay Avionics, Ltd, CRS# HM1R197K

DATE 10 -04-11 AC HRS 1698.9

N<u>654MS</u>

DATE

I CERTIFY THAT THE ALTIMETER, SALTITUDE REPORTING AND STATIC SYSTEM TESTS REQUIRED BY CFR 91.411 HAVE BEEN PERFORMED. TESTS WERE PERMORMED TO 20, 000

ALT. 10-64-2011

THIS ATK 33 TRANSPONDER S/N 89105006 HAS BEEN TESTED AND FOUND TO BE IN COMPLIANCE WITH THE REQUIREMENTS OF CFR 91.413(PART 43 APP F).

10-04-2011

SIGNED

BAY AVIONICS, LTD. HM1R197K

ร สโขรมเราห Flight Censer 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-319-4973

N654MS

AFTT: 1373.9

Date: 12/15/2011

Complied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Closed all panels. Installed new LH linings. Installed new Powerplow collector and muffler insert in accordance with Powerflow report number PFS-15250-00 rev E. Installed new LH tire with new. Installed new main canopy aft seal. Performed touch up painting in various locations. Installed new lower ventral fin skid plate p/n DA4-5183-00-61. Installed new nose wheel bearing p/n 08125. I certify that this aircraft has been inspected in accordance with a 100 hour inspection was found to be airworthy.

Wayne C. Newton AP3450425 IA

Wayne Mewton

EVIZTION

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS

Tach reads: 1475.1. AFTT:1475.1

Date 6/1/12

Complied with an annual inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Closed all panels. Complied with an ELT inspection in accordance with FAR 91.207(d). Battery due 3/13. Installed new LH brake linings. Rotated RH tire on wheel. Repacked RH brake caliper and bled brakes.Resecured trim on glareshield. I certify that this aircraft has been inspected in accordance with an annual inspection was found to be airworthy.

Wayne C. Newton AP3450425 IA

Wayne & newfor

AVIATION

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

N654MS

ach reads: 1494.5

Removed battery Concorde p/n RG24-15M due to extremely high amp draw. Installed new battery of ame part number. Ground run and ogs check of electrical system QK.

Dirk Van den Brink AP3637044 Mh Call

AVIATION

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 2613

ach reads: 1526.5

installed new right hand brake linings. Removed old carpet on pilot and co-pilots footwells. Cleaned adhesive residue. Installed new carpet. Installed new lamp in flap indicator. Ops checks OK.

EPIXTION

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS

Tach reads: 1574.7 AFTT:1574.7

Date 10/18/12

Complied with a 100 hour inspection in accordance with FAR 43 Appendix D. Removed and replaced Emergency battery. P/N D60-2560-91-00, s/n 12-256-22. Battery due time change September 2014. nstalled new rudder cables using Diamond rudder cable kit p/n CSKIT-04. Rigged rudder system per DA40 maintenance manual. Removed and disassembled LH nav light assembly. Installed new lamp and eassmbled light. OPs check OK. Relocated registration holder to baggage area as required. Installed new rudder bonding jumper. I certify that this aircraft has been inspected in accordance with a 100 hour nspection was found to be airworthy

Wayne C. Newton AP3450425 IA

EPIX AVIATION

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 sapeake, Virginia 23323 757-421-4973

N654MS wo 3907

Tach reads 1607.7

11/2712

Jacked aircraft and removed right main wheel assembly. Disassembled and inspected wheel. Cleaned and inspected wheel bearings. Packed wheel bearings. Installed new Goodyear Flight Custom III tire and nner tube. Reassembled wheel. Reinstalled wheel assembly on aircraft. Removed aircraft from jacks.

James Parkman AP 3270184

1

EPIX AVIATION

EPIX AVIATION. LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS

Fach reads: 1623.8

Date: 12-27-2012

Removed and replaced left and right main landing gear brake linings. Installed new cabin door lock cylinder assys.

Dirk Vandenbrink AP3637044

EVIZTION

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 5254

Tach reads: 1674.7 AFTT:1674.4

Complied with an Annual inspection in accordance with FAR 43 Appendix D. Opened all panels. Lubricated aircraft. Torqued right axle to strut fasteners. Relined right brake, I certify that this aircraft has been inspected in accordance with an Annual Inspection was found to be airworthy.

Wayne C. Newton AP3450425 IA

Warms Mewfe

AS REQUIRED FOR COMPLET

EVIATION

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS

NATURE LICENCE NUMBER

Date: 5-17-13

Complied with an ELT inspection in accordance with FAR 91.207(d). Battery expires 6/15.

lames E. Parkman AP3270184 IA

EPIZITION

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

N654MS wo 5666

Date: 5/23/2013

Removed defective wing walk tape from right and left wings, cleaned affected areas installed new tape as required.

William Rickard AP2960804

EPIX AVIATION, LLC

N654MS WO 6207

Tach reads: 1715.8

Date: 7/3/13

Removed wheel pant fairing. Removed brake caliper assembly. Disassembled, cleaned and inspected caliper. Installed new caliper piston o-ring. Reassembled caliper. Reinstalled caliper and bled brake. Ground checks OK

irk Vandenbrink AP363704

AVIATION

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS

Tach reads: 1768.3 Engine total time: 0 since new

Date 12-16-13

nstalled this engine IO360-M1A s/n RL-3841-51E on a Diamond DA40 s/n 40.842, Reg N654MS. The ngine was installed in accordance with the DA40 Maintenance manual with new engine isolators and polts. Engine was serviced with 8 qts of Phillips 20W50. The engine was run up and the idle speed and dle mixture was set. The engine was leak checked. The engine was broken in in accordance with ycoming Service instruction 1427C. This engine is approved for returne to service.

mes Parkman AP3270184 IA

LICENCE

NUMBER

EVIZTION

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS

Tach reads: 1768.3 AFTT:1768.3

12/16/13

Complied with an ANNUAL inspectation air filter. Inspected ELT in accordance with FAR 91.207(d). No defects noted. Battery due 3/2018. Rotated left tire on wheel. Installed new nose landing gear. Rubber elements p/n DIN 9835-63x50 and DIN 9835-32x40. Ground run and leak check OK. certify that this aircraft has been inspected in accordance with an ANNUAL inspection was found to be

S AS REQUIRED FOR COMPLET Complied with an ANNUAL inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated airworthy N 65+M3 DATE 12-17-13 AC HRS 2309.6 I CERTIFY THAT THE ALTIMETER, ALTITUDE REPORTING AND STATIC SYSTEM TESTS REQUIRED BY CFR 91.411 HAVE BEEN PERFORMED. TESTS WERE PERMORMED TO 34 000 12-17-13 DATE ENCODER 12-17-13 DATE STATIC SYSTEM_ 12-17-13 TRANSPONDER S/N 89/0 5006 THIS G TX- 33 HAS BEEN TESTED AND FOUND TO BE IN COMPLIANCE WITH THE REQUIREMENTS OF CFR 91.413(PART 43 APP F). 12-17-13 INSPECTOR

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

BAY AVIONICS, LTD. HM1R197K

N654MS wo 8652

Date: 4/18/14

Pilot reports no alternator output. Removed and charged battery. Checked all wiring at alternator. Checked wiring at voltage regulator. Found minor corrosion on pins in cannon plug at regulator. Cleaned and reassembled. Reinstalled battery. Test run OK.

Dirk van den Brink AP 3637044

ENGINEERING RECORD

EVIZTION

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

N654MS wo 9795

NATURE

8/20/14

Tach reads: 1870,3 AFTT:1870.3 Hobbs reads: 2440.1

Complied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Closed all panels. Installed new induction air filter p/n FR-08504. Installed new left main tire. In Installed new right main wheel brake disc RA164-24400 and linings p/n APS66-14100. Complied with AD 2011-26-04, Fuel injector lines, Next due at 1970.3. AD2014-13-08 Wing spar modification is **NOT** due at this time. AD2014-13-08 is due 2370.3 AFTT or January31, 2024. Washed engine. Ground run and leak certify that this aircraft has been inspected in accordance with a 100 hour inspection was found to be

Wayne C. Newton AP3450425
Wayne Planton

EPIX * AVIATION EPIX AVIATION, LLC

N654MS wo 10245

Tach reads: 1896.40 AFTT:1896.4

Date 10/1/14

Removed and replaced Emergency battery. P/N D60-2560-91-00, Battery due time change October 2016. Tested ELT in accordance with FAR 91.207(d).



Barrier Island Aviation, Ltd.

N654MS 10-19-14

Tach: 1915.60

Replaced Ih main tube with McCreary Artra 15x 6.00-6 . Ground run good. Andy Rosman 3524208 A&P

AVIATION

EPIX AVIATION, LLC

N654MS wo 10509

ach reads: 11919.8

Date: 10-24-14

Removed and replaced left brake lining p/n 066-14100. Ground checks OK

William Rickard AP 29603



BROUG

FORW.



2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 10799

Tach reads: 1955.4

Date: 12/1/14

lacked aircraft and removed main wheel assembly. Disassembled and inspected wheel. Cleaned and aspected wheel bearings. Packed wheel bearings. Installed new 15X600-6pr tire and reassembled wheel. Reinstalled wheel assembly on aircraft. Removed aircraft from jacks.

Dirk Van den Brink AP 3637044



EPIX AVIATION, LLC peake, Virginia 23323 757-421-4973

N654MS wo 10958

Tach reads: 1969.8 AFTT:1969.8

Complied with an Annual inspection in accordance with FAR 43 appd D. Opened all panels, Lubricated aircraft. Closed all panels. Inspected ELT inaccordance with FAR 91.207(d). No defects noted. Battery due 6-15. Cleaned and serviced induction air filter. Installed new ring in left brake caliper. Serviced and bled brakes as required. Installed new bulbs p/n W1290-28, in right and left nav lights. Ops checks OK. Installed new static wick on LH aileron. Washed engine. Ground run and leak check OK.

certify that this aircraft has been inspected in accordance with an Annual inspection was found to be

James Parkman AP 3270184 IA



FPIX AVIATION 11 C 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 11376

Tach reads: 1985.8

Date: 2/7/15

Jacked aircraft and removed main wheel assembly. Disassembled and inspected wheel, Cleaned and nspected wheel bearings. Packed wheel bearings. Installed new 15X600-6pr tire and reassembled wheel. Reinstalled wheel assembly on aircraft. Removed aircraft from jacks. Oil pressure, fuel flow, & pitot heat inop. Verified components OK. Inspected wiring. Could not duplicate fault. Aircraft returned to service.

Dirk Van den Brink AP 3637



EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323

N654MS WO#11599

Tach reads: 1999.6

Date: 3/2/15

RT Brake sluggish. Replaced O-ring in brake caliper. Replaced brake liners. Bled brake system. Ops check OK. Aircraft returned to service.

Wayne Newton AP3450425 IA

Warm Men for

DURED FOR COMPLET

EVIATION

EPIX AVIATION, LLC

N654MS wo 12255

LICENCE SIGNATURE NUMBER

Tach reads: 2010.7

Date: 5/11/15

Removed and replaced GRS 77. Installed overhauled unit p/n 011-00868-10 s/n 42021843. Installed new oftware compatibility update. Work was accomplished in accordance with the Garmin G1000 line maintenance manual and Garmin G1000 Field Update Instructions - Diamond DA 40 & DA 40 F 190-00544-03. Rev 10 dated May 2013. Ground checks OK.

Dirk van den Brink AP3637044



EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 12500

Tach reads: 2015.9

Date: 6-17-15

Replaced ELT batteries with Duracell MN1300 "D" cell batteries, checked per ACK E-01 manual nspected per FAR91,207(d). No discrepancies noted. Re-installed in aircraft. Next Due June 2017.

irk Van den Brink AP3637

A N F H E T 18	201
AVIFILL	a aw

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 12500

ach reads: 2015.9

Date: 6-17-15

Prained oil. Removed and inspected filter. No defects noted. Installed new filter p/n 48110-2. Serviced ngine with 7 qts of Phillips 20w50. Washed engine. Ground run and leak check OK.

Wayne C. Newton AP3450425

Wayne Mew for see Engine Soq Book Br. Sign off Wayne Mewler



EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 12904

Tach reads: 2042,90

Jacked aircraft and removed LH main wheel assembly. Disassembled and inspected wheel. Cleaned and respected wheel bearings. Packed wheel bearings. Installed new 15X600-6pr tire with a new tube and eassembled wheel. Reinstalled wheel assembly on aircraft. Removed aircraft from jacks.

Show Beion

ENGINEERING RECORD

EPIZTION	EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Ctresapeake, Virginia 23323 757-421-4973 EpixAviation.com	N654MS wo 13904
aircraft. Inspected ELT inaccorda	ion in accordance with FAR 43 appd D. o ince with FAR 91.207(d). No defects not sled and serviced brakes. Cleaned and ti	ahtened connector for L/H white

nav light. Installed new rubber strap on tail pipe bracket. Replaced cabin heat scat tubing. Replaced

grounding straps at flap push rods under rear L/H seat. Complied with essential bus check and static

certify that this aircraft has been inspected in accordance with an Annual inspection was found to be

bonding check in accordance with Diamond maintenance manual. Repaired crack in tail skid with fiberglass, then painted. Installed new nose gear tube p/n 5.00x5. Remove nose wheen to clean, readjusted nose wheel castering force. Tightened L/H main landing gear axle bolts. Ground run and leak

S AS REQUIRED FOR COMPLETE

EPIX * ENTRIES. DRA AVIATION

EPIX AVIATION 2802 Airport Drive, Suite Chesapeake, Virginia 23323 757-421-4973

N654MS wo 16344

LICENCE

Tach reads: 2145.30

Date: 4/27/2016

Jacked aircraft and removed LH main wheel assembly. Disassembled and inspected wheel. Installed new 15X600-6 ply tire with a new tube and reassembled wheel. Reinstalled wheel assembly on aircraft. Removed aircraft from jacks.

Shirleen Bergren AP3804009

Shun Bug

EPIXTION

lames Parkman AP 3270184 IA

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

N654MS wo 14581

Date: 12-22-2015

Fach reads: 2511.6

airworthy

nstall new door lock and fit new key to match the baggage door lock.

DATE_	01-26	-16
_		

AC HRS 27 48.2

N 654MS

I CERTIFY THAT THE ALTIMETER, ALTITUDE REPORTING AND STATIC SYSTEM TESTS REQUIRED BY CFR 91.411 HAVE BEEN PERFORMED. TESTS WERE PERMORMED TO 20,000

01-26-16

ALT. 01-26-16

DATE

ENCODER 01-2-6-16

STATIC SYSTEM THIS 6-7X-33

TRANSPONDER S/N 89/05006 HAS BEEN TESTED AND FOUND TO BE IN COMPLIANCE WITH THE REQUIREMENTS OF CFR 91.413(PART 43 APP F).

01-26-16

SIGNED

INSPECTOR

BAY AVIONICS, LTD, HM1R197K

CARRIED FORWARD

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 16344

Tach reads: 2145.9

Removed and replaced light bulb p/n A50828, Ops check Good

Shirleen Bergren AP3804009

Emily Suev

EPIZTION

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 17129

Date: 5/2/2016

ach reads: 2175.1 AFTT:2175.1

Complied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Cleaned and serviced induction air filter. Removed pilot side wing walk. Cleaned affected area. nstalled new wing walk. Gained access to a resecured and tightened magneto/ start switch. Ground run

certify that this aircraft has been inspected in accordance with a 100 hour inspection was found to be airworthy.

William Rickard AP2960804



EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 18787

Tach reads: 2220.7 AFTT:2220.7

10/14/16

Complied with an Annual inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Cleaned and serviced induction air filter. Complied with an ELT inspection in accordance with FAR 91.207(d). No defects noted. Battery due 6-17. Complied with Powerflow Ehaust system ICA. Checked and set nose wheel castering force. Installed new Emergency battery p/n D60-2560-91-00. Next due eplacement 10-2018, Removed and replaced lower comm antenna p/n DMC63-2. Ops checks OK. Complied with AD 2015-19-07 in accordance with Lycoming SB342G. No defects noted. Next due at 2320.7 AFTT Ground run and leak check OK.

certify that this aircraft has been inspected in accordance with an Annual inspection was found to be

James E. Parkman AP3270184IA

HI SOMOTAY AVE

OR COMPLET

LICENCE

NUMBER

DATE

BROUGHT FORWARD

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 19376

Tach reads: 2225.10

Date: 11/15/2016

Troubleshot system IAW Whelen troubleshooting instructions. Determined strobe power pack is bad. Ground off screw head to remove wing tip for access to strobe power supply. Installed new nut plate as required; Installed new power supply, Ops check OK

Shirleen Bergren AP3804009

Sulus Benga

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS

wo 19571

Tach reads: 2231.9

Date: 11/29/2016

Muffler insert missing parts/damaged. Removed muffler, ground off damaged screws and removed damaged insert, Drilled new holes for new insert, assembled muffler with new insert p/n PFS-0016,

Dirk Van den Brink AP3637044



EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS

Tach reads: 2235.7

Date: 12/8/2016

Map reading lights inoperative; Pulled down all three light fixtures, cleaned out RTV, Checked bulbs, all OK. 1 switch found dirty. Cleaned, ops checked, OK, 2 light switches found broken from "excessive actuation pressure", cleaned, applied epoxy adhesive, clamped and allowed to cure overnight. Reinstalled, RTVd fixtures back into place, cleaned up.; Camloc fastener missing from top/front of RH inboard main gear wheel pant access panel; installed new Camloc fastener in place of broken fastener;

Dirk Van den Brink AP3637044



EPIX AVIATION 2802 Airport Drive, Suite Chesapeake, Virginia 23323 757-421-4973

N654MS wo 20641

Tach reads: 2242.6 AFTT: 2242.6

2/13/2017

Removed glare shield to gain access to stall horn. Removed stall horn and replaced reed in horn Reinstalled horn and glare screen, ops check good.

Shirleen Bergren AP 3804009

Shum Beren

Eciation

ENTRIES. DRAW A

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

N654MS wo 22039

Tach reads: 2256,8 AFTT: 2256,8

5/10/2017

Jacked aircraft and removed RH main wheel assembly, Disassembled and inspected wheel. Installed new tire p/n 072-449-0 (15X6.0-6 Tire) and reassembled wheel with new tube p/n 097-500-0 (15X6.0-6 Tube). Reinstalled wheel assembly on aircraft. Removed aircraft from jacks.

Shirleen Bergren AP3804009

green Buen

EPIZTON

2802 Airport Drive, Suite Chesapeake, Virginia 23323 757-421-4973 EpixAviation con

N654MS wo 22507


Tach reads: 2268.8 AFTT: 2268.8

Date 6/7/2017

Removed ELT, disassembled ELT and inspected batteries. Reassembled ELT with new case p/n E0103 and tested. Ops check good. Reinstalled ELT in aircraft and closed aft bulkhead panels. Batteries due DEC 2024

Shirleen Bergren AP3804009

Thum Bergy

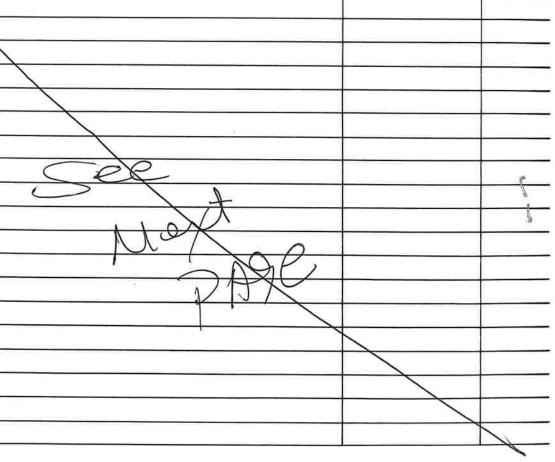

AIR TIME AND

ENGINEERING RECORD

LICENCE NUMBER

	DAILY	TOTAL TIME S	AIR		TEEDING SECOND	EPIX AVIATION, LLC
	TOTAL	MF			NEERING RECORD	3802 Airport Drive Suite 1 N654MS
	HRS. MIN.	HRS.	MIN.	NUIL: USE BOTH PAGES AND A	S MANY LINES AS REQUIRED FOR COMPLETE	Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com 8/18/17
		i i				8/18/17 8/18/17
T D	EPIX +			PIX AVIATION, LLC ! Airport Drive, Suite 1	N654MS	Tach reads: 2319.5 AFTT:2319.5
			Ches	sapeake, Virginia 23323 757-421-4973	wo 18787	Complied with an Annual inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated
400	aviatij	W 4 W		FpixAviation.com	<u>WO 18787</u>	
						11 A4 007/A) NO DEJECTS HOUSE SAME A
Tact	h reads: 2251 AF	TT: 2251			3/29/2017	and cot nose wheel date and cot nose wheel date and the date at
						III A A ABOOKE THE COMMISSION TO THE TAIL THE THE TAIL TH
Rem	moved cowling, re	moved batte	ry cover ar	nd battery, Installed battery same pa	art number s/n 40870412,	
re-co	cowled aircraft and	d ran. Opera	tional chec	ks good.		Ground run and leak check OK. Ground run and leak check OK.
-						Ground run and leak check OK. Ground run and leak check OK. I certify that this aircraft has been inspected in accordance with an Annual inspection was found to be
					-	airworthy. Wayee Chewter
Shir'	rleen Bergren AP	3804009				Wayne C. Newton AP 3450425 IA
					-	Wayne C, Newton M 5 15 1
		11110	·) (Seap		EPIX AVIATION, LLC
-		M				2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323
	· ·					(31-421-4913 WU 24033 L
						Tach reads: 2345.5 Ar 11.2545.5
:48				EPIX AVIATION	11054145	Removed and replaced shattered right hand rear nav light bulb, PN A508-28. Ops check OK.
	EPIX		280 Che	02 Airport Drive, Suite 1 esapeake, Virginia 23323	N654MS	TANK TO SEE THE PROPERTY OF TH
4	AVIATI	u su		757-421-4973 EpixAviation.com	wo 23303	
-						Dirk van den Brink, Jr.
[⊤] a	Tach reads: 2296.	D			Date 7/21/2017	A&P 3637044
le:	stalled new RH s	trobe flack +	ihe n/n 02 i	025026-00		
— IIIs	eraned HeAt LLU 2	none lidali li	ine hui 05-	020020-00.		11/1 2//
						- Canada Caracteria Ca
	Line D	D2004000				
— ∥ ^{Sh}	hirleen Bergren A	r3804009		1		
	٠ (م		R	agr)		
	S/1	mi	S DW	~y -		EPIX AVIATION, LLC
	00.	-				EPRX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 Epii Aviation com wo 25705
						757-421-4973 EpixAviation.com
	e: (X)	1:	(1)			Tach reads: 2389.5 AFTT:2389.5
	450	2			-	
		4.		EPIX AVIATION 2802 Airport Drive, Suite 1	N654MS	Jacked aircraft and removed RH main wheel assembly. Disassembled and inspected wheel. Installed new tire Condor 15X6-00-6 p/n 072-449-0 with new tube p/n 097-500-0 and reassembled wheel.
	EPIX	71000		Chesapeake, Virginia 23323 757-421-4973	wo 23966	Reinstalled wheel assembly on aircraft. Removed aircraft from jacks.
	AVIA	a a gra		EpixAviation.com	Date: 14AUG2017	The state of the s
	Tach reads: 23	316.6				
					-	
				main wheels. Jacked aircraft and rem		William Rickard AP2960804
	iii Replaced fire v			-4. Retorqued wheel bolts to 150 in-lb ed with new linings p/n; 066-14100. F		1 1-11-11
				pers with new o-rings p/n: MS28775-2	224 and reinstalled	(Mallakit)
	linings on both both wheels. C			ake pads and the LH Tire to the axle.		
	linings on both both wheels. C calipers onto the	ne wheels. R	einstalled br		ned IAVV Diamond DA-40	
	linings on both both wheels. C calipers onto th master cylinde	ne wheels. R rs. Reinstalle	einstalled br	ings on both wheels. All work perform		
	linings on both both wheels. C calipers onto th master cylinde Maintenance M	ne wheels, R rs. Reinstalle Ianual	einstalled br d wheel fair			
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair	ings on both wheels. All work perform		EDIY AVIATION U.C.
	linings on both both wheels. C calipers onto th master cylinde Maintenance M	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 N654MS
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 T57-421-4973 Wo 26592
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 T57-421-4973 EpixAviation.com
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 T57-421-4973 Wo 26592
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			Tach reads: 2419.6 AFTT:2419.6 Complied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			Tach reads: 2419.6 AFTT:2419.6 Complied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Cleaned and serviced induction air filter. Complied with Powerflow Exhaust system ICA.
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			Tach reads: 2419.6 AFTT:2419.6 Complied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Cleaned and serviced induction air filter. Complied with Powerflow Exhaust system ICA. Checked and set nose wheel castering force. Complied with AD 2015-19-07 in accordance with Lycomic
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			Tach reads: 2419.6 AFTT:2419.6 Complied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Cleaned and serviced induction air filter. Complied with Powerflow Exhaust system ICA. Checked and set nose wheel castering force. Complied with AD 2015-19-07 in accordance with Lycomi SB342G. No defects noted. Next due at 2519.5 AFTT. Repaired affected area on top cowling at enlarged.
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			Tach reads: 2419.6 AFTT:2419.6 Complied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Cleaned and serviced induction air filter. Complied with Powerflow Exhaust system ICA. Checked and set nose wheel castering force. Complied with AD 2015-19-07 in accordance with Lycomi SB342G. No defects noted. Next due at 2519.5 AFTT. Repaired affected area on top cowling at enlared fastener. Painted with color and installed cowling fastener. Removed flap indicator assembly and installed new lamp. Reinstalled assembly. Ops checks Ok. Installed new left and righ brake linings p/n
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			Tach reads: 2419.6 AFTT:2419.6 Tomplied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Cleaned and serviced induction air filter. Complied with Powerflow Exhaust system ICA. Checked and set nose wheel castering force. Complied with AD 2015-19-07 in accordance with Lycomi SB342G. No defects noted. Next due at 2519.5 AFTT. Repaired affected area on top cowling at enlared fastener. Painted with color and installed cowling fastener. Removed flap indicator assembly and installed new lamp. Reinstalled assembly. Ops checks Ok. Installed new left and righ brake linings p/n 066-14100 and new discs Ground run and leak check OK.
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			Tach reads: 2419.6 AFTT:2419.6 Tomplied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Cleaned and serviced induction air filter. Complied with Powerflow Exhaust system ICA. Checked and set nose wheel castering force. Complied with AD 2015-19-07 in accordance with Lycomi SB342G. No defects noted, Next due at 2519.5 AFTT, Repaired affected area on top cowling at enlared fastener. Painted with color and installed cowling fastener. Removed flap indicator assembly and installed new lamp. Reinstalled assembly. Ops checks Ok. Installed new left and righ brake linings p/n 066-14100 and new discs Ground run and leak check OK. I certify that this aircraft has been inspected in accordance with a 100 hour inspection was found to be
	linings on both both wheels. C calipers onto the master cylinde Maintenance M Robert William	ne wheels, R rs, Reinstalle 1anual s	einstalled br d wheel fair			Tach reads: 2419.6 AFTT:2419.6 Tomplied with a 100 hour inspection in accordance with FAR 43 appd D. Opened all panels. Lubricated aircraft. Cleaned and serviced induction air filter. Complied with Powerflow Exhaust system ICA. Checked and set nose wheel castering force. Complied with AD 2015-19-07 in accordance with Lycomi SB342G. No defects noted. Next due at 2519.5 AFTT. Repaired affected area on top cowling at enlared fastener. Painted with color and installed cowling fastener. Removed flap indicator assembly and installed new lamp. Reinstalled assembly. Ops checks Ok. Installed new left and righ brake linings p/n 066-14100 and new discs Ground run and leak check OK.

AIR TIME AND

	DAIL		ACUDE SIGN 4	NGSUMS		
DATE	101		P AC HRS 3/80,0		CORD S AS REQUIRED FOR	
	HRS. IC	STEM TESTS F	THE ALTIMETER ⁽³ ALTITUDE F REQUIRED BY CFR 91.411 H/	AVE DEEM PERFORMED.	AS REQUIRED FOR COMPLETE	E
BROUGHT FORWARD		TESTS WEI	RE PERMORMED TO <u> </u>	<u>///δ</u> FT.		
		ALT	02-06-18	DATE		
	1	ENCODER	02-06-18	DATE		
	+	STATIC SY	STEM 02-06-18	DATE		
		THIS CTX	33TRANSPONDER	S/N 59105086		
		HAS BEEN TEST	TED AND FOUND TO BE IN C REMENTS OF CFR 91.413(P/	OMPLIANCE WITH THE		
	D	ATE	2-06-18			
	s	IGNED	add W. Culpipp	4		
			BAY AVIONICS, LTD. HM1R	197K		
	1	1 1				
— <u>[</u>			EPIX AVIATION			
📆	?/X_**;	n)	2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973	<u>N654MS</u> wo 28726	1	
	Marine Marine	9 27	EpixAviation com			
Tach	reads: 2448.2			Date 4/30/18		
- Donlo		off atroba tuba wi	ith on hand used serviceable sp	are n/n A610. One checks OK		
Kepia	iced inoperative L	en Shobe tube w		are printed of a opa direction of a		
— Repla	iced inoperative L	eit Stiobe tabe Wi		are principle opa directions.		
— Repla	aced inoperative L	eit stiobe tube w	,	are pringoro, opa diledike ork		
	aced inoperative L	eit stiode tabe w	•	are pin Aora, opsarione or a		
	nced inoperative L			are pri Acro, ope areano ern		
				are pri Acro, ope areano ern		
				are pri Acro, ope areano ern		
				are pri Acro, ope areano ern		
				аге ригдото, оро опсоло от с		
				аге ригдото, оро опсоло от с		
				аге ригдото, оро опсоло от с		
Samn	ny Lancaster AP	3861194 2802	EPIX AVIATION, LLC 2 Airport Drive, Suite 1			
Samn		3861194 2802	EPIX AVIATION, LLC Airport Drive. Suite 1 sapeake, Virginia 23323 757-421-4973	N654MS wo 30827		
Samn	ny Lancaster AP	3861194 E 2802 Ches	EPIX AVIATION, LLC A Airport Drive, Suite 1 sapeake, Virginia 23323	N654MS		
Samn Tach reads:	my Lincaster AP 3	3861194 Eagli Ches	PIX AVIATION, LLC P. Airport Drive, Suite 1 sapeake, Virginia 23323 757-421-4973 EpixAviation.com	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft.		
Samn Tach reads: 2 Complied with Cleaned and	ny Uncaster AP 3	3861194 E 2802 Cheston in accordance air filter. Complie	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 sapeake, Virginia 23323 757-421-4973 EpixAviation.com	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No		
Tach reads: Complied wit Cleaned and defects notes set nose whe	th an Annual inspect serviced induction d. Battery due 12-2bel castering force.	Basel 194 E 2802 Chest 292 Stion in accordance air filter. Complied with Removed and rep	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 sapeake, Virginia 23323 757-421-4973 EpixAviation.com e with 14 CFR 43 appendix D. Oped d with an ELT inspection in accord n Powerflow Exhaust system ICA, laced transponder antenna p/n CI-	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil		
Tach reads: Complied wit Cleaned and defects notes set nose whe service door new sealant	th an Annual inspect serviced induction d. Battery due 12-20el castering force. Corrected wiring to the bases of all a	assential and assential and assential and assential asse	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 sapeake, Virginia 23323 757-421-4973 EpixAviation.com with 14 CFR 43 appendix D. Opei d with an ELT inspection in accord p Powerflow Exhaust system ICA. laced transponder antenna p/n Cla- deplaced missing and damaged face d bonding straps on flap controls u	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil teners in engine baffling. Applied nder rear seats. Replaced missin		
Tach reads: Complied wit Cleaned and defects notes set nose whe service door new sealant fasteners in r	th an Annual inspect to the bases of all aright wingtip and not to the bases of all aright wingtip and no	as a coordance air filter. Complied with Removed and repon EGT 1 and 3. Remirements Repaired se wheel pant. Re	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 sapeake, Virginia 23323 757-421-4973 EpixAviation.com e with 14 CFR 43 appendix D. Oper d with an ELT inspection in accord a Powerflow Exhaust system ICA. laced transponder antenna p/n Cl- teplaced missing and damaged fas d bonding straps on flap controls u stated tires on rims to even out wea	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil teners in engine baffling. Applied der rear seats. Replaced missing.r. Performed corrosion control on		
Tach reads: Complied wit Cleaned and defects noter set nose whe service door, new sealant if fasteners in r and repainter switches in t	2519.2 AFTT:2519 th an Annual inspect I serviced induction d. Battery due 12-2i eel castering force. Corrected wiring to the bases of all a right wingtip and no d all landing gear le	as a contained and paintennas. Repaired see wheel pant. Register and paintennas. Repaired see wheel pant. Register illed and paintennas method and painten	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 2 Airport Drive, Suite 1 2 Sapeake, Virginia 23323 757-427-4973 EpixAviation.com with 14 CFR 43 appendix D. Oper d with an ELT inspection in accord in Powerflow Exhaust system ICA, laced transponder antenna p/n Cl- leplaced missing and damaged fas d bonding straps on flap controls u tated tires on rims to even out wea nted chips in paint along the leadin replaced bulb in third mao light. In	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil teners in engine baffling. Applied inder rear seats. Replaced missing. Performed corrosion control on g edges of both wings. Repaired installed new non-skid walkway		
Tach reads: Complied wit Cleaned and defects noter set nose whe service door, new sealant if fasteners in r and repainter switches in t	2519.2 AFTT:2519 th an Annual inspect I serviced induction d. Battery due 12-2i eel castering force. Corrected wiring to the bases of all a right wingtip and no d all landing gear le	as a contained and paintennas. Repaired see wheel pant. Register and paintennas. Repaired see wheel pant. Register illed and paintennas method and painten	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 sapeake, Virginia 23323 757-421-4973 EpixAviation.com e with 14 CFR 43 appendix D. Oper d with an ELT inspection in accord a Powerflow Exhaust system ICA, laced transponder antenna p/n Cl- teplaced missing and damaged fas d bonding straps on flap controls utated tires on rims to even out we anted chips in paint along the leadin	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil teners in engine baffling. Applied inder rear seats. Replaced missing. Performed corrosion control on g edges of both wings. Repaired installed new non-skid walkway		
Tach reads: Complied wit Cleaned and defects noter set nose whe service door, new sealant if fasteners in r and repainter switches in t	2519.2 AFTT:2519 th an Annual inspect I serviced induction d. Battery due 12-2i eel castering force. Corrected wiring to the bases of all a right wingtip and no d all landing gear le	as a contained and paintennas. Repaired see wheel pant. Register and paintennas. Repaired see wheel pant. Register illed and paintennas method and painten	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 2 Airport Drive, Suite 1 2 Sapeake, Virginia 23323 757-427-4973 EpixAviation.com with 14 CFR 43 appendix D. Oper d with an ELT inspection in accord in Powerflow Exhaust system ICA, laced transponder antenna p/n Cl- leplaced missing and damaged fas d bonding straps on flap controls u tated tires on rims to even out wea nted chips in paint along the leadin replaced bulb in third mao light. In	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil teners in engine baffling. Applied inder rear seats. Replaced missing. Performed corrosion control on g edges of both wings. Repaired installed new non-skid walkway		
Tach reads: Complied wit Cleaned and defects note set nose whe service door new sealant if fasteners in r and repainte switches in t material on le aircraft has b	2519.2 AFTT:2519 th an Annual inspect I serviced induction d. Battery due 12-2i eel castering force. Corrected wiring to the bases of all a right wingtip and no d all landing gear le	assembled with an accordance air filter. Complied with Removed and repon EGT 1 and 3. Rentennas. Repaired assembled with the repondent of the repondent of the resembled with an accordance with a cordance wit	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 2 Airport Drive, Suite 1 2 Sapeake, Virginia 23323 757-427-4973 EpixAviation.com with 14 CFR 43 appendix D. Oper d with an ELT inspection in accord in Powerflow Exhaust system ICA, laced transponder antenna p/n Cl- leplaced missing and damaged fas d bonding straps on flap controls u tated tires on rims to even out wea nted chips in paint along the leadin replaced bulb in third mao light. In	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil teners in engine baffling. Applied inder rear seats. Replaced missing. Performed corrosion control on g edges of both wings. Repaired installed new non-skid walkway		
Tach reads: Complied wit Cleaned and defects note set nose whe service door new sealant if fasteners in r and repainte switches in t material on le aircraft has b	2519.2 AFTT:2519 th an Annual inspect serviced induction d. Battery due 12-20 ele castering force. Corrected wiring to the bases of all aright wingtip and not d all landing gear le wo of the interior over the wing. Replaced per inspected in an aright wing.	assembled with an accordance air filter. Complied with Removed and repon EGT 1 and 3. Rentennas. Repaired assembled with the repondent of the repondent of the resembled with an accordance with a cordance wit	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 2 Airport Drive, Suite 1 2 Sapeake, Virginia 23323 757-427-4973 EpixAviation.com with 14 CFR 43 appendix D. Oper d with an ELT inspection in accord in Powerflow Exhaust system ICA, laced transponder antenna p/n Cl- leplaced missing and damaged fas d bonding straps on flap controls u tated tires on rims to even out wea nted chips in paint along the leadin replaced bulb in third mao light. In	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil teners in engine baffling. Applied inder rear seats. Replaced missing. Performed corrosion control on g edges of both wings. Repaired installed new non-skid walkway		
Tach reads: Complied wit Cleaned and defects note set nose whe service door new sealant fasteners in r and repaintet switches in t material on le aircraft has b	2519.2 AFTT:2519 th an Annual inspect serviced induction d. Battery due 12-20 ele castering force. Corrected wiring to the bases of all aright wingtip and not d all landing gear le wo of the interior over the wing. Replaced per inspected in an aright wing.	assembled with an accordance air filter. Complied with Removed and repon EGT 1 and 3. Rentennas. Repaired assembled with the repondent of the repondent of the resembled with an accordance with a cordance wit	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 2 Airport Drive, Suite 1 2 Sapeake, Virginia 23323 757-427-4973 EpixAviation.com with 14 CFR 43 appendix D. Oper d with an ELT inspection in accord in Powerflow Exhaust system ICA, laced transponder antenna p/n Cl- leplaced missing and damaged fas d bonding straps on flap controls u tated tires on rims to even out wea nted chips in paint along the leadin replaced bulb in third mao light. In	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil teners in engine baffling. Applied inder rear seats. Replaced missing. Performed corrosion control on g edges of both wings. Repaired installed new non-skid walkway		
Tach reads: Complied wit Cleaned and defects note set nose whe service door new sealant fasteners in r and repaintet switches in t material on le aircraft has b	2519.2 AFTT:2519 th an Annual inspect serviced induction d. Battery due 12-20 ele castering force. Corrected wiring to the bases of all aright wingtip and not d all landing gear le wo of the interior over the wing. Replaced per inspected in an aright wing.	assembled with an accordance air filter. Complied with Removed and repon EGT 1 and 3. Rentennas. Repaired assembled with the repondent of the repondent of the resembled with an accordance with a cordance wit	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 2 Airport Drive, Suite 1 2 Sapeake, Virginia 23323 757-427-4973 EpixAviation.com with 14 CFR 43 appendix D. Oper d with an ELT inspection in accord in Powerflow Exhaust system ICA, laced transponder antenna p/n Cl- leplaced missing and damaged fas d bonding straps on flap controls u tated tires on rims to even out wea nted chips in paint along the leadin replaced bulb in third mao light. In	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil teners in engine baffling. Applied inder rear seats. Replaced missing. Performed corrosion control on g edges of both wings. Repaired installed new non-skid walkway		
Tach reads: Complied wit Cleaned and defects note set nose whe service door new sealant fasteners in r and repaintet switches in t material on le aircraft has b	2519.2 AFTT:2519 th an Annual inspect serviced induction d. Battery due 12-20 ele castering force. Corrected wiring to the bases of all aright wingtip and not d all landing gear le wo of the interior over the wing. Replaced per inspected in an aright wing.	assembled with an accordance air filter. Complied with Removed and repon EGT 1 and 3. Rentennas. Repaired assembled with the repondent of the repondent of the resembled with an accordance with a cordance wit	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 2 Airport Drive, Suite 1 2 Sapeake, Virginia 23323 757-427-4973 EpixAviation.com with 14 CFR 43 appendix D. Oper d with an ELT inspection in accord in Powerflow Exhaust system ICA, laced transponder antenna p/n Cl- leplaced missing and damaged fas d bonding straps on flap controls u tated tires on rims to even out wea nted chips in paint along the leadin replaced bulb in third mao light. In	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil teners in engine baffling. Applied inder rear seats. Replaced missing. Performed corrosion control on g edges of both wings. Repaired installed new non-skid walkway		
Tach reads: Complied wit Cleaned and defects note set nose whe service door new sealant if fasteners in r and repainte switches in t material on le aircraft has b	2519.2 AFTT:2519 th an Annual inspective corrected wiring force. Corrected wiring to the bases of all aright wingtip and not all landing gear lew of the interior over the wing. Replaced per inspected in an aright wing.	assembled with an accordance air filter. Complied with Removed and repon EGT 1 and 3. Rentennas. Repaired assembled with the repondent of the repondent of the resembled with an accordance with a cordance wit	EPIX AVIATION, LLC 2 Airport Drive, Suite 1 2 Airport Drive, Suite 1 2 Sapeake, Virginia 23323 757-427-4973 EpixAviation.com with 14 CFR 43 appendix D. Oper d with an ELT inspection in accord in Powerflow Exhaust system ICA, laced transponder antenna p/n Cl- leplaced missing and damaged fas d bonding straps on flap controls u tated tires on rims to even out wea nted chips in paint along the leadin replaced bulb in third mao light. In	N654MS wo 30827 17 August 2018 ned all panels. Lubricated aircraft. ance with FAR 91.207(d). No No defects noted. Checked and 105. Repaired loose lock on oil teners in engine baffling. Applied inder rear seats. Replaced missing. Performed corrosion control on g edges of both wings. Repaired installed new non-skid walkway		

CARRIED FORWARD

ENGINEFRING PECODO

ECIXTON

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

N654MS WO 32425

11/2/18

LICENCE C

Removed and replaced the emergency backup battery in accordance with Diamond DA40-180 AMM Chapter 4 Airworthiness Limitations, para 1B "Replacement Requirements. Work accomplished by Sean Ennis and supervised by the undersigned.

Dirk Van den Brink AP 3630744

ESIXTION

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

N654MS wo 33323 Date: 01/04/19

Tach reads: 2595.10

Opened interior. Tested OAT probe resistance per specifications given by Garmin. Found out of tolerance. Removed probe and installed new probe P/N 011-00978-00. Tested system, reads correct OAT. Closed up interior.

William A. Rickard A&P 2960804

Tach reads: 2621.1 AFTT:2621.1

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 34524

3/21/1

Complied with a 100 hour inspection in accordance with FAR 43 Appendix D. Removed exterior panels and interior furnishings as required to facilitate inspection of all aircraft structures, control systems and attach points. Lubricated aircraft. Cleaned and serviced induction air filter. Complied with Powerflow Exhaust system ICA. No defects noted. Checked and set nose wheel castering force. Removed, clean, inspected and repacked LH and RH brake calipers. Serviced and bled brakes. Installed new tube and overhauled tire on nose landing gear. Ground run and leak check OK.

certify that this aircraft has been inspected in accordance with a 100 hour inspection was found to be airworthy.

William Rickard AP2960804

Elizion

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

N654MS wo 35056

Tach reads: 2640.4

Date: 4/17/19

Jacked aircraft and removed main wheel assembly. Disassembled and inspected wheel. Cleaned and inspected wheel bearings. Packed wheel bearings. Installed new 15X600-6pr tire and reassembled wheel. Installed new brake caliper bleed fitting p/n 079-00300 and new brake linings p/n 066-14100. Reinstalled wheel assembly on aircraft. Removed aircraft from jacks.

Dirk Van den Brink AP 3637044

EPIX AVIATION

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

Eliation. DATE BROUGHT Jacked aircraft and removed LH main wheel assembly. Disassembled and inspected wheel. Cleaned and FORWARD procedure and removed Lin main wheel assembly. Disassembled and inspected wheel, Gleaned and inspected wheel bearings. Packed wheel bearings, Installed new 15X600-6pr tire and reassembled wheel. inspected wheel bearings. Packed wheel bearings, installed new 13,000-opt tire and reassembled wheel, installed new brake linings p/n RA66-14100. Reinstalled wheel assembly on aircraft. Removed aircraft installed new brake illlings p/π κροσ-14100. Reinstalled wheel assembly on aircraπ. Remo\ from jacks. Work performed by Sean Ennis and supervised and inspected by the undersigned. 3. Form Tracking Number: SI175930 Dirk Van den Brink AP 3637044 5. Work Order/Contract/Invoi N/A 11. Status/Work:

NEW

ZVIATION

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

8/2/19

N654MS

wo 37493

N654MS

wo 12904

6/17/19

FOR COMPLETE

Tach reads: 2730.2

DA-40 nav light hardware stuck. Cut and drilled outs crew, Installed new lamp p/n A50828, Ops check OK.

William Rickard AP2960804

EPIX W AVIATION

EPIX AVIATION, LLC 2802 Airport Drive, Suite Chesapeake, Virginia 23323 757-421-4973 N654MS wo 38090 12/19/19

complied with an Annual inspection in accordance with 14 CFR 43 Appendix D. Opened all panels, fairings, and interior omponents as required to facilitate inspection. Inspected fuselage, wings, tail surfaces, cabin, cockpit, landing gear, and all related systems. Serviced and lubricated components and systems as required. Complied with an ELT spection IAW 14 CFR 91.207(d). No discrepancies noted. ELT battery due 12/2024. Aft passenger door safety latch was lubricated. Pilot canopy lock was removed and replaced with p/n 623062454, 3802-0022. Baffling fastener under ylinders #2 and #4 was replaced. Fuel pressure sender adel clamp was replaced with new Adel clamp and silicone tape. Baffling at cylinder #3 was replaced. Fuel pressure sender adel clamp was replaced with new Adel clamp and silicone tape. Baffling at cylinder #3 was repositioned. Right wing flap removed for installation of new p/n MB01-55, LN9037-M5X24, and DA4-5751-00-62MOD. Left wing flap removed for installation of new p/n LN9037-M5X24, DA4-5751-00-62MOD, and DI1481-1.5X10-A2. Left wing was removed, roller cage assembly p/n DS-RG3 was installed, and wing was re-installed. Seat airbag system was removed and replaced with new p/n 509667-217 and new EMA module p/n 508358-421. Complied with G1000 and GFC700 ICAs, and installed 5 p/n AGC 3.2A. RH wing bulb holder screw hole repaired. Left wing-tip nutplate repaired. Closed all panels, fairings, and interior components opened for inspection; ground run and leak check OK. I certify that this aircraft has been inspected in accordance with an Annual inspection was found to and leak check OK. I certify that this aircraft has been inspected in accordance with an Annual inspection was found to Dirk van den Brink, Jr. A&P 3637044 IA

EVIZTION

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 44305 Date: 20 March 2020

Tach reads: 2774.50

Bled right side brake system. Adjusted elevator trim damper tension in accordance with Diamond DA-40-180 maintenance manual. Re-attached right hand wing stub seal strip with trim adhesive.

Dirk van den Brink, Jr. A&P 3637044



2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 45761 5/15/2020

LICENCE IGNATURE NUMBER

Tach reads: 2791,90

Jacked aircraft and removed RH main wheel assembly. Disassembled and inspected wheel. Installed Jacked allocate and removed for main wheel assembly. Blacked and inspected wheel installed new 15X600-6pr tire and reassembled wheel. Reinstalled wheel assembly on aircraft. Removed aircraft

Work performed by Glenn Cleveland and supervised by the undersigned.

birk van den Brink, Jr. A&P 3637044

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 51476 Date: 18 Sept 2020

Tach reads: 2850.1 AFTT: 2850.1

Complied with a 100 Hour inspection in accordance with 14 CFR 43 Appendix D. Opened all panels, fairings, and interior components as required to facilitate inspection. Inspected fuselage, wings, tail surfaces, cabin, cockpit, landing gear, and all related systems. Serviced and lubricated components and systems as required. Replaced nose gear shock rubbers with 5 each of P/N DA4-9032-23-01. Replaced both main gear brake discs with P/N RA164-024400 and snock ruppers with 5 each of P/N DA4-3032-23-01. Replaced both main year brake discs with P/N DA4-3032-23-01. Replaced both main year brake linings P/N 066-14100. Removed, disassembled, cleaned, and installed new seals and o-rings in both pilot side brake master cylinders. Replaced several faded exterior placards, Closed all panels, fairings, and interior components opened for inspection. I certify that this aircraft has been inspected in accordance with a 100 Hour inspection and was determined to be in airworthy condition.

William A. Rickard A&P 2960804



EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 52045 Date: 29 Sept. 2020

Tach reads: 2855,00

Complied with Diamond Service Bulletin OSB 40-069 "Coated Safety Walk".

William Rickard A&P 296080

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 56321 Date: 21 Dec 2020

Replaced inline fuse for pilot side rudder pedal adjustment. Installed new G1000 emergency battery pack. Replaced A509-28 bulb in right hand position light.

Dirk van den Brink, Jr. A&P 3637044

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

Jacked aircraft and removed LH main wheel assembly. Disassembled and inspected wheel. Cleaned and

nspected wheel bearings. Packed wheel bearings. Installed new 15X600-6pr tire and reassembled wheel.

rom jacks. Work performed by Sean Ennis and supervised and inspected by the undersigned.

inspected wheel bearings. I acked while bearings, installed wheel assembly on aircraft. Removed aircraft installed new brake linings p/n RA66-14100. Reinstalled wheel assembly on aircraft.

DATE 3-12-20 AC HRS 276 4.4

N654MS

I CERTIFY THAT THE ALTIMETER, ALTITUDE REPORTING AND STATIC SYSTEM TESTS REQUIRED BY CFR 91.411 HAVE BEEN PERFORMED.

TESTS WERE PERMORMED TO 20, 6 20

3-12-20

DATE

NUMBER

LICENCE

THIS ATK 3.3 TRANSPONDER S/N \$9/05 656
HAS BEEN TESTED AND FOUND TO BE IN COMPLIANCE WITH THE REQUIREMENTS OF CFR 91.413(PART 43 APP F).

3-12-20

SIGNED RONDOW. GULDEPAL

BAY AVIONICS, LTD. HM1R197K

EVIZTON

Fach reads: 2791.90

Jacked aircraft and removed RH ma new 15X600-6pr tire and reassemble from jacks.

Nork performed by Glenn Cleveland a

birk van den Brink, Jr. A&P 3637044

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

N654MS wo 51476 Date: 18 Sept 2020

Tach reads: 2850.1 AFTT: 2850.1

Complied with a 100 Hour inspection in accordance with 14 CFR 43 Appendix D. Opened all panels, fairings, and interior components as required to facilitate inspection. Inspected fuselage, wings, tail surfaces, cabin, cockpit, landing gear, and all related systems. Serviced and lubricated components and systems as required. Replaced nose gear shock rubbers with 5 each of P/N DA4-9032-23-01. Replaced both main gear brake discs with P/N RA164-024400 and all four brake linings P/N 066-14100. Removed, disassembled, cleaned, and installed new seals and o-rings in both pilot side brake master cylinders. Replaced several faded exterior placards. Closed all panels, fairings, and interior components opened for inspection. I certify that this aircraft has been inspected in accordance with a 100 Hour nspection and was determined to be in airworthy condition.

Villiam A. Rickard A&P 2960804

AVIATION

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 52045 Date: 29 Sept. 2020

Tach reads: 2855.00

Complied with Diamond Service Bulletin OSB 40-069 "Coated Safety Walk".

William Rickard A&P 296

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 56321 Date: 21 Dec 2020

Replaced inline fuse for pilot side rudder pedal adjustment. Installed new G1000 emergency battery pack. Replaced A509-28 bulb in right hand position light.

Dirk van den Brink, Jr. A&P 3637044

EPIX Y AVIATION

Dirk Van den Brink AP 3637044

EPIX AVIATION 2802 Airport Drive, Suite 1 esaneake, Virginia 23323 757-421-4973 EpixAviation.com

N654MS wo 37493

N654MS

wo 12904

6/17/19

8/2/19

FOR COMPLETE

Tach reads: 2730.2

DA-40 nav light hardware stuck, Cut and drilled outs crew. Installed new lamp p/n A50828. Ops check OK.

William Rickard AP2960804

EUZTEN

Tach reads: 2692.1

DATE

BROUGHT

3. Form Tracking Number:

5.Work Order/Contract/In-

11. Status/Work:

SI175930

N/A

NEW

FORWARD

EPIXTION Tach reads: 2744.7 AFTT: 2744.7 EPIX AVIATION, LLC 2802 Airport Drive, Suite Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com **N654MS** wo 38090 12/19/19

complied with an Annual inspection in accordance with 14 CFR 43 Appendix D. Opened all panels, fairings, and interior imponents as required to facilitate inspection. Inspected fuselage, wings, tail surfaces, cabin, cockpit, landing gear, components as required to facilitate inspection. Inspected fuselage, wings, tail surfaces, cabin, cockpit, landing gear, and all related systems. Serviced and lubricated components and systems as required. Complied with an ELT inspection IAW 14 CFR 91.207(d). No discrepancies noted. ELT battery due 12/2024. Aft passenger door safety latch was lubricated. Pilot canopy lock was removed and replaced with p/n 623062454, 3802-0022. Baffling fastener under cylinders #2 and #4 was replaced. Fuel pressure sender adel clamp was replaced with new Adel clamp and silicone tape. Baffling at cylinder #3 was repositioned. Right wing flap removed for installation of new p/n MB01-55, LN9037-M5X24, and DA4-5751-00-62MOD. Left wing flap removed for installation of new p/n LN9037-M5X24, DA4-5751-00-62MOD, and DI1481-1.5X10-A2. Left wing was removed, roller cage assembly p/n DS-RG3 was installed, and wing was re-installed. Seat airbag system was removed and replaced with new p/n 509667-217 and new EMA module p/n 508358-421. Complied with G1000 and GFC700 ICAs, and installed 5 p/n AGC 3.2A. RH wing bulb holder screw hole repaired. Left wing-tip nutblate repaired. Closed all panels fairings, and interior components obened for inspection: ground run

Left wing-tip nutplate repaired. Closed all panels, fairings, and interior components opened for inspection; ground run and leak check OK. I certify that this aircraft has been inspected in accordance with an Annual inspection was found to

Dirk van den Brink, Jr. A&P 3637044 IA

Chesapeake, Virginia 23323 757-421-4973

N654MS wo 44305 Date: 20 March 2020

Tach reads: 2774.50

Bled right side brake system. Adjusted elevator trim damper tension in accordance with Diamond DA-40-180 maintenance manual. Re-attached right hand wing stub seal strip with trim adhesive.

Dirk van den Brink, Jr. A&P 3637044

EPIZTION

Tach reads: 2912.3 AFTT: 2912.3

hesapeake, Virginia 23323 757-421-4973

Complied with an ANNUAL inspection in accordance with 14 CFR 43 Appendix D. Opened all panels, fairings, and interior components as required to facilitate inspection. Inspected fuselage, wings, tail surfaces, cabin, cockpit, landing gear, and all related systems. Serviced and lubricated components and systems as required. Complied with

an ELT inspection in accordance with 14 CFR 91.207(d). No discrepancies noted. ELT battery due December

interior components opened for inspection. I certify that this aircraft has been inspected in accordance with an

2024. Cleaned and re-torqued bolts on nose fork stops, re-set castering force. Tightened loose bolt on left flap at

nboard end at lorque tube. Repaired bonding straps on right flap bellcrank. Replaced tailpipe glass pack on PowerFlow exhaust. Complied with Garmin G1000 ICAs, no discrepancies noted. Closed all panels, fairings, and

N654MS wo 57384 Date: 29 Jan 2021 CORD AS REQUIRED FOR COMPLETE

Tach reads: 3045.3

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

lacked aircraft and removed RH main wheel assembly. Disassembled and inspected wheel. Cleaned and nspected wheel bearings. Packed wheel bearings. Installed new 15X600-6pr tire and reassembled wheel.

Removed and replaced RH brake linings p/n RA66-14100. Removed LH wheel pant and bracket and

emainder of right hand bracket. Reinstalled wheel assembly and linings on aircraft. Removed aircraft

N654MS Wo 63601 Date: 08/10/2021

k Order/Contract/Invoio TURE

itatus/World:

I'm Tracking

rom jacks. Nork performed by Glenn Cleveland. Supervised and inspected by the undersigned.

2802 Airport Drive, Suite

Chesapeake, Virginia 23323 757-421-4973

acked aircraft and removed LH main wheel assembly. Disassembled and inspected wheel. Installed new

5X600-6pr tire and reassembled wheel Reinstalled wheel assembly on aircraft, Removed aircraft from

acks. Work performed by Glen Cleveland and supervised and inspected by the undersigned.

Dirk van den Brink, Jr. AP 3637044

AVIATION

Tach reads: 3093,7

EPIX W AVIATION

Dirk van den Brink, Jr., A&P IA 3637044

2802 Airport Drive, Suite Chesapeake, Virginia 23323 757-421-4973

N654MS wo:57744 2/9/2021

Tach reads: 2915.6

Removed and replaced right hand position light with pn: A508-28.

ANNUAL inspection and was determined to be in airworthy condition.

Work performed by Glenn-Cleveland, supervised, and inspected by the undersigned.

Dirk van den Brink, Jr. AP 3637044

EPIX AVIATION 2802 Airport Drive. Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 59320

Tach reads: 2933.8

AVIATION

4/3/21

Jacked aircraft and removed RH main wheel assembly. Disassembled and inspected wheel. Cleaned and nspected wheel bearings. Packed wheel bearings, Installed new 15X600-6pr tire and reassembled wheel. installed new brake linings p/n RA66-14100. Reinstalled wheel assembly on aircraft. Removed aircraft from jacks. Work performed by Zach Parkman and supervised and inspected by the undersigned.

lames E. Parkman AP3270184

AVIATION 2950,7 30

2802 Airport Drive, Suite Chesapeake, Virginia 23323 757-421-4973 EpixAviation cor

N654MS wo 60570 Date: 17 May 2021

Complied with a 100 Hour inspection in accordance with 14 CFR 43 Appendix D. Opened all panels, fairings, and nterior components as required to facilitate inspection. Inspected fuselage, wings, tail surfaces, cabin, cockpit, landing gear, and all related systems. Serviced and lubricated components and systems as required. Replaced all four brake inings P/N 066-14100. Installed new bearings and races in the LH main wheel, Installed new tire on the LH main wheel, Cleaned and treated minor corrosion on rudde fixed tab, Closed all panels, fairings, and interior components opened for inspection. I certify that this aircraft has been inspected in accordance with a 100 Hour inspection and was determined to be in airworthy condition.

Willn William A. Rickard A&P 2960804 EPIX + AVIATION

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 63926 Date: 8-31-21

Tach reads: 3051.6 AFTT: 3051.6

Complied with a 100 Hour inspection in accordance with 14 CFR 43 Appendix D. Opened all panels, fairings, and interior components as required to facilitate inspection. Inspected fuselage, wings, tail surfaces, cabin, cockpit, landing gear, and all related systems. Serviced and lubricated components and systems as required. Installed new jack pads p/n DV2-1200-02. Installed new lamp in RH nav light., p/n A508-28. Closed all panels, fairings, and interior components opened for inspectiop. I certify that this aircraft has been inspected in accordance with a 100 Hour inspection and was determined to be in airworthy condition.

10 Dirk Van den Brink AP 3637044

	STIATION
ĺ	Tach reads: 3051.6 ETT: 3051.6

ames E. Parkman AP 3270184

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 63926 Date: 8-31-21

N654MS

wo 65400

10/4/21

Complied with a 100 HOUR inspection in accordance with 14 CFR 43 Appendix D. Opened all cowls, fairings, and other components as required to facilitate inspection. Drained oil, inspected oil filter, no defects noted. Installed new AA48110-2 oil filter and serviced with 7qts Phillips X/C Aviation 20W50 oil. Compressions with 80psi input pressure are as follows: 70/76/70/60. Checked magneto liming. Cleaned, gapped, and rotated spark plugs. Replaced one spark plug. Complied with AD 2015-19-07 "Fuel injector fuel lines" In accordance with Lycoming Service Bulletin SB342G. No discrepancies noted. Next due at 3151.6 tach time. Run up and leak checked engine after inspection and service, no discrepancies noted. Reinstalled all cowls, fairings, and other components previously removed to

certify that this engine has been inspected in accordance with a 100 HOUR inspection and was determined to be in airworthy condition

Dirk Van den Brink AP 3637044

LICENCL

SIGNATURE

EP/Artion

Tach reads: 3078,90

BROUGH

FORWAF

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 Epix Aviation.com

Cleaned the trim drag rod with alcohol, rig and test IAW DA-40-180 AMM 27-38-00 paragraph 3,

Accomplished by G. Cleveland and supervised and inspected by the undersigned.

N654MS wo 65091 9/24/21

EPIX AVIATION
2802 Airport Drive, Suite 1
Chesapeake, Virginia 23323
757-421-4973
EpixAviation.com

N654MS wo 68865 Date: 23 Feb 2022

Tach reads: 3147.1 AFTT: 3147.1

Complied with an ANNUAL inspection in accordance with 14 CFR 43 Appendix D. Opened all panels, fairings, and interior components as required to facilitate inspection. Inspected fuselage, wings, tail surfaces, cabin, cockpit, and interior components as required to facilitate inspection. Inspected fuselage, wings, tail surfaces, cabin, cockpit, and interior components and systems as required. Complied with landing gear, and all related systems. Serviced and lubricated components and systems as required. Complied with an ELT inspection in accordance with 14 CFR 91.207(d). No discrepancies noted. ELT battery due Dec 2024, Replaced SCAT-12 duct into and out of cabin heat muff. Replaced rivets on lower right side mount for lower cowl. Replaced right main tire on rim. Replaced left gear brake linings. Resealed rear passenger door window. Installed Carmin GDL-82 ADS-B out system in accordance with FAA Policy Memorandum, Installation Approval for ADS-B OUT Systems, dated March 2, 2016. Closed all panels, fairings, and interior components opened for inspection. I certify that this aircraft has been inspected in accordance with an ANNUAL inspection and was determined to be in airworthy condition.

INSPECTION, REPAIRS & REPLACEMENT

ENTRIES, DRAW A DIAGONAL LINE THROUGH ANY UNUSED LINES IN DATE AND TIME COLUMNS.

Dirk van den Brink, Jr. A&P IA 3637044

EVIZTION

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 66661 Date: 11/17/2021

Tach reads: 4078,70

Drained oil, removed and inspected filter. No discrepancies noted. Installed new AA48110-2 oil filter and serviced with 7qt Phillips XC 20W50 oil. Ran up and leak checked, no discrepancies noted.

William A Rickard A&P 2960894

EVIZTION

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 66952

Tach reads: 3112.70 AFTT: 3312.70 12/14/2021

Removed cowling, removed battery cover and battery. Installed battery part number RG24-15M, S/N41190045 and cover,re-cowled aircraft and ran. Operational checks good.

Work performed by Sean Ennis HB0003 Inspected by Jason Tyler Parris AP3562767



EPIXTION

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 Epix Aviation.com

N654MS wo 67590 Date: 12/20/21

Tach reads: 3115.50

Removed left hand wingtip and troubleshot system. Found strobe tube inoperative, Replaced with new 02-0250276-00 strobe tube. Ops check good. Reinstalled wingtip.

Dirk van den Brink, Jr. A&P 3637044

57/200n

2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation.com

N654MS wo 69996 3/19/22

Tach reads: 3163.3

Removed inoperative boost pump p/n 5100-00-9CJ s/n 4129 and installed p/n 5100-00-9CJ s/n 4487 $_{\circ}$ Leak and ops checks Ok.

James E. Parkman

AP 32/0184

James 3 Jankus

EVIZTION

EPIX AVIATION
2802 Airport Drive, Suite 1
Chesapeake, Virginia 23323
757-421-4973
Epix Aviation com

N654MS wo:70489 Date: 3/29/2022

Tach reads: 3167.0

Removed alternator and replaced alternator with P/N ALU-8521R, S/N H-V112010.

Work performed by Sean Ennis, supervised, and inspected by the undersigned.

James Parkman AP 3270184 IA

James 3 Panlana

14a

LICENCE

*

SIGNATURE

BROUGH

EPIX * AVIATION

N654MS wo 65091

9/24/21

RED FOR COMPLETE

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973 EpixAviation con

INSPECTION, REPAIRS & REPLACEMENT ENTRIES. DRAW A DIAGONAL LINE THROUGH ANY UNUSED LINES IN DATE AND TIME COLUMNS.

> **N654MS** wo 68865

Date: 23 Feb 2022

Tach reads: 3147.1 AFTT: 3147.1

Complied with an ANNUAL inspection in accordance with 14 CFR 43 Appendix D. Opened all panels, fairings, Complied with all related systems. Serviced and lubricated components and all related systems. Serviced and lubricated components and all related systems. Serviced and lubricated components and all related systems. landing gear, and all related systems. Serviced and lubricated components and systems as required. Complied with an ELT inspection in accordance with 14 CFR 91.207(d). No discrepancies noted. ELT battery due Dec 2024. Replaced SCAT-12 duct into and out of cabin heat mulf. Replaced rivets on lower right side mount for lower cowl. Rolated right main tire on rim. Replaced left gear brake linings. Resealed rear passenger door window. Installed Garmin GDL-82 ADS-B out system in accordance with FAA Policy Memorandum, Installation Approval for ADS-B OUT Systems, dated March 2, 2016. Closed all panels, fairings, and interior components opened for inspection. I certify that this aircraft has been inspected in accordance with an ANNUAL inspection and was determined to be in airworthy condition. and interior components as required to lacintate inspection. Inspected resetage, wings, tall surfaces, cabin, cockpit, landing gear, and all related systems. Serviced and lubricated components and systems as required. Complied with

Dirk van den Brink, Jr. A&P IA 3637044

Cleaned the trim drag rod with alcohol, rig and test IAW DA-40-180 AMM 27-38-00 paragraph 3,

Accomplished by G. Cleveland and supervised and inspected by the undersigned.

N654MS wo 66661 Date: 11/17/2021

Tach reads: 4078.70

Tach reads: 3078.90

subsection C.

Drained oil, removed and inspected filter. No discrepancies noted, Installed new AA48110-2 oil filter and serviced with 7qt Phillips XC 20W50 oil. Ran up and leak checked, no discrepancies noted

William A Rickard A&F

EPIX AVIATION, LLC 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 66952

Tach reads: 3112.70 AFTT: 3312.70 12/14/2021

Removed cowling, removed battery cover and battery. Installed battery part number RG24-15M, S/N41190045 and cover re-cowled aircraft and ran. Operational checks good.

Work performed by Sean Ennis HB0003 Inspected by Jason Tyler Parris AP3562767



EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 67590 Date: 12/20/21

Tach reads: 3115,50

Removed left hand wingtip and troubleshot system. Found strobe tube inoperative. Replaced with new 02-0250276-00 strobe tube. Ops check good. Reinstalled wingtip.

Dirk van den Brink, Jr. A&P 3637044

AVIATION

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo 69996 3/19/22

Tach reads: 3163,3

Removed inoperative boost pump p/n 5100-00-9CJ s/n 4129 and installed p/n 5100-00-9CJ s/n 4487. Leak and ops checks Ok.

James E. Parkman

AVIATION

EPIX AVIATION 2802 Airport Drive, Suite 1 Chesapeake, Virginia 23323 757-421-4973

N654MS wo:70489 Date: 3/29/2022

Tach reads: 3167.0

Removed alternator and replaced alternator with P/N ALU-8521R, S/N H-V112010.

Work performed by Sean Ennis, supervised, and inspected by the undersigned.

James Parkman AP 3270184 IA

*		
4	_	
	-	
-		
	-	
ľ	-	
	9	
1		
3		
3		
Ĭ		
3		
Ĕ		
Z.		
2		
ă:		1
e		l
ed		
7		4
ž.		
₹		-
fo		
7		
Ē.		
28		
e		
6		
mar work the component is considered ready for release to service under I	41 III 41	
3		
ice	Ì	
n n	¢	
nd	1	
er	5	
_	2	

	T DAI	LY	TOTAL TIME SI MFG	AIR NCE			ENGINEER	RING R	ECORD	-		RIES. DRAW A DIA
E	тот	MIN.	HRS.	MIN.	NOTE: U	JSE BOTH P	AGES AND AS MA	NY LIN	S AS REQUIRED FOR COME	LETE	ENT	
	HRS.	MIN.	Make: Di	amond		L	Model: DA 40		N#: N654MS	1		Make: Diamo
ROUGHT			Sortt: 40	842	Ai	ircraft Tot	al Time: 3258.	5	Tach:3258.5	-		Ser#: 40.84
FORWARD	+		Inchecte	ad aircr	aft IAW I	Manufacti	urers Checklist	Dated	04-13, Including			Inspected a
/	4	-	1 000 a	nd 2 00	n hour it	ems. Clea	ned, checked	and lul	ped all controls.			checked an
		1	ر مین مین	d Draka	rocervoi	ir with flui	d as needed. (Checke	d, serviced and			needed. Ch
			-	l hattar	a Clean	ed check	ed and lubrica	ted lar	iding gear. Kemoved, 📗	1		Greased al
			charge	Datter	od and r	nainted so	rews for landi	ng bez	el. Replaced LT MLG			to corrosio
		+	- cleaned	, prepi	peu anu p	is s n-sph	v cleaned pre	pped a	nd painted inboard	-		Run up, lea
		+	_ tire and	tube \	w/ new 1	- Bonlace	d NIG tire W	new 5	5.00-5 6Ply tire and		1	
		A	_ wheel	half for	corrosio	n. Kepiace	erako caliner n	ins of	corrosion. Cleaned,			"I certify
		Ţ.	tube. C	leaned	both IVIL	G Wheel r	s due to corro	sion ∆	II Ads checked to		ts.	l con many
-	_		checke	d and l	ubed rud	ider ninge	s due to corro	un les	k and OPS checks			
		+	— Biweel	dy upda	ate 2023 [.]	-12, see II	st in logs. Kuli	սբ, ուշ	k and OPS checks			
			good.									- //
			"I cor	+ify tha	at this Air	rcraft has	been inspecte	ed IAW	an annual inspection	1 -11-13-14		
			- I cei	tity tite	and fo	und to be	in an airwort	hy con	dition."			
		-			unio : s				Date: 06/16/23			
		_		_	/	711	1		Butch Guy = 17	1		Make: AC
					m	2/12	2	C V:	rtz III A&P#141525863I/			Ser#: 0590
						1/2				4	-	3E1#. 0350
				TE	K Aircraft s	service 942 l	Union Branch Roa	au, Cura				La superior d
			Make:	. ACK			Model: E-01		N#: N654MS			Inspected
		\rightarrow		059041			1		Tach:3258.5			
·			Ser#:	059041			A	ircraft	Total Time: 3258.5			
					- 1 4 1 4 1 5 .	04 207 /			Battery due 12/24			
П			— Insped	cted EL	T IAW Fa	r91.207 (a), 110 delects	TIOCCU.	Jacon y Mari	16.1		
									Date: 06/16/23			
			_ _		7/	4 10						
				/1	n	910	Thom	E K	urtz III A&P#141525863I	A	111	11
					<u> </u>						69/01/	
		-		TE	K Aircraft	service 942	Union Branch Ro	ad, Cora	peake NC 27926	J.	TAC ?	3443.4
1												Make: Diam
ı				_								Ser#: 40.84
1	7-			-								Inspected
												checked a
								-				needed. C
											-	
				-			0					— Biweekly ι
									U			good.
										_46	1	"I certify
	-											
				- +							-	
	\											
										1.70		1/1
•					V	CARRIE	D FORWARD					100

INS S. DRAW A DIAGONAL	PECTION, REPAIRS & REPLACEMEN LINE THROUGH ANY UNUSED LINES IN	DATE AND TIME COLUMNS.	SIGNATURE	NUM
Make: Diamond	Model: DA 40	N#: N654MS	To the second	
6	Aircraft Total Time: 3358.0	Tach:3358.0		
Inspected aircraft checked and luber needed. Checked,	IAW Manufacturers Checklist Dat d all controls. Serviced Brake rese serviced and charged battery. Cla bearings. Cleaned, checked and I ds checked to Biweekly update 20	eaned, checked and ubed rudder hinges due	· · · · · · · · · · · · · · · · · · ·	
"I certify that th	is Aircraft has been inspected IA\ nd found to be in an airworthy co	W an annual inspection indition."		
11	9 1 0	Date: 03/29/24		
10m	Thomas E. R	Curtz III A&P#141525863IA		
TEK Airo	raft service 942 Union Branch Road, Cor	apeake NC 27926		
				7
- 1 COV	Model: E-01	N#: N654MS		1
Make: ACK	Model. E-01	Tach:3358.0		1.
Ser#: 059041	Int	t Total Time: 3358.0		
		The second secon		
Inspected ELT IA\	N Far 91.207 (d), no defects note	a. Battery due 12/24		
Thu	5/12	Date: 03/29/24		
		Kurtz III A&P#141525863IA		
TEK Air	craft service 942 Union Branch Road, Co	rapeake NC 27926		
4 Freli	aced Both MLG Bro 4741198 2 Model: DA 40	ne limings W/ New	uaits,	9202/62/4
Ser#: 40,842	Aircraft Total Time: 3456.9	Tach:3456.9		10
	The second of th			25
	IAW Manufacturers Checklist Dad all controls. Serviced Brake rese			••
			- a k t-	0
	, serviced and charged battery. Al 2024-20, see list in logs. Run up, l		· · · · · · · · · · · · · · · · · · ·	Da
	is Aircraft has been inspected IA nd found to be in an airworthy co			FR

Date: 10/15/24

Thomas E. Kurtz III A&P#141525863

TEK Aircraft service 942 Union Branch Road, Corapeake NC 27926

AIR TIME AND

DATE		NILY OT AL	TOTA TIME MF	L AIR SINCE G.	ENG	INEERING RECORD	
DATE	HRS.	MIN.	HRS.	MIN.	NOTE: USE BOTH PAGES AND	AS MANY LINES AS REQUIRED FO	R COMPLE
BROUGHT	1	Make: D			Model: DA 40	N#: N654MS	
FORWARD		Ser#: 40		LA	ircraft Total Time: 4783.7	Tach:4783.7	
	Removed electric boost pump, (P/N# 5100-00-9CJ, Ser#: 4487), and replaced it with new unit, (P/N: 5100-00-9CJ, Ser#: MC00130. Ops/Leak						
	-				-		
		checks	good. Re	eplaced	both MLG tires W/new reca	p units from Wilkerson.	
	1						
		The abo	ove wor	k was p	erformed within the curren	t rules of the FAA and is	
					pproved for return to service		
					pp.		
	+	1 _	11	٠.	2052	Date: 11/21/24	
		-	/	20	9/2		
		1	u	~/,	Thomas E	. Kurtz III A&P#141525863	
			TEK A	ircraft se	rvice 942 Union Branch Road, Cora	apeake NC 27926	
		-					
		_		3			S
	+	+	-	1			
	+	-	1	+			
			-	-			
2 V		-	+	+			
	-	+	+	-			
							0.5%
						C E	- 1
		+	+	+			
		_	-	4			
	-	+	-	+			
			1				
	\vdash			1			
		_	-	+			
				T			
				1			
	_			+			

Airframe Logbook Date: 10/14/2025



Date: 10/14/2023		AIRCRAFT SALES & BROKERAGE	
Reg No: N654MS	Aircraft Type: DA-40	Aircraft S/N: 40.842	
AFTT: 3502.5	Hobbs: 4828.5	Engine TT: 1734.2	

- 1. Performed 2000-hour inspection IAW Diamond MM; 05-28-50. Removed wings from aircraft and pulled fuel tanks, examined fuel tanks for leaks, reinstalled fuel tanks after weld repair, measured toe and camber of main landing gear. Performed tap test on top on bottom of wing structure. Examined wing bolts and lubricated with Aeroshell 22 upon reinstallation. Removed and installed flap and Aileron push rods after examination. Reinstalled wings and leak checked fuel tanks. Performed operational check of all flight controls, operational checks of exterior lighting and Pitot heat, Performed engine runs and operational checks of all engine systems. No defects noted for the work performed.
- 2. Performed MSI inspection IAW Diamond MM; 05-28-50. Performed tap test of top and bottom fuselage shells, inspected inner skin of vertical stabilizer, removed and inspected inner skin of horizontal stabilizer. Inspected inner structure of rear fuselage. Inspected inner wing skin with fuel tanks removed. Installed horizontal stabilizer and confirmed rigging of elevator.
- 3. Performed essential buss inspection IAW Dimond MM; 24-00-00. Checked and confirmed proper function of Essential bus switch and wires associated for chaffing and proper installation.
- 4. Performed 1000-hour electrical bonding check IAW Diamond MM; 51-80-00.
- 5. AD-2024-19-08; Complied with by installation of new nose landing gear leg P/N: D41-3223-10-00_2-ASY. No further action required, this part replacement is terminating the actions required by paragraph (h)(1) of this AD.
- 6. AD-2014-13-08; Complied with AD by performing inspection and installation of aft main spar stiffener per para. 4(i) of this AD and following INSTRUCTIONS section of Diamond Aircraft Industries GmbH Work Instructions WI-MSB 40-074, WI-MSB D4-094, and WI-MSB F4-028 (copublished as a single document), dated May 10, 2013, as specified in Diamond Aircraft Industries GmbH Mandatory Service Bulletins (MSB) 40-074, D4-094, and F4-028 (co-published as a single document), dated May 10, 2013. no further action is required.
- 7. Performed hard landing check due to excessive bend and negative camber in LH and RH struts in accordance with 05-50 in the diamond maintenance manual. Removed and replaced both main gear legs due to excessive bending, installed serviceable RH gear strut PN: D41-3213-12-50-1 and serviceable LH gear strut PN: D41-3213-11-50-1. Installed in accordance with diamond maintenance manual 32-10-00. Shimmed and adjusted camber and toe as necessary.
- 8. Installed new ACK E-04, SN: 050905 406 MHZ ELT and the following components, Antenna PN: E-04.8, Suppressor PN: E-04.10.1.12, Buzzer PN: E-04.7 and CR2 battery due every 10 years, Panel switch PN: E-04.5 with 28L battery due every 10 years. ELT battery expires Aug, 2030. Operational
- 9. Performed Garmin ICA's and installed new slow blow fuses.
- 10. Installed new brake rotors on both main gear PN: RA164-24400 and new brake linings PN: RA066-14100.
- 11. Installed new bearings and races on all gear legs. Nose race PN: 08231, nose bearing PN:08125, Main race PN: 13836, main bearings PN: 13889.
- 12. Resealed each caliper with MS28775-224 serviced with MIL PREF 5606 and bled brakes.
- 13. Installed new grip tape on entry steps and painted.
- 14. Installed new Carpet kit from SCS interiors PN: 100220-2029, see SCS W/O: 83760-01 for burn certs.
- Installed new Plenum G1000 filter PN: DA4-2163-10-02. 15.
- 16. Installed new brake clamps PN: 420420_1.
- 17. Installed multiple new fuel vent and small interconnect hoses on RH middle and outboard tank PN: 110W016030.
- 18. Installed new sealant and O rings on fuel filler cap PN: DIN3771-85X6FPM.
- Installed new O rings on both fuel tank drain valves PN: DA4-9028-17-03, PN: M25988-011. 19.
- 20. Installed new NLG stop sheet PN: D41-3223-00-51.
- 21. Installed Pneumatic door damper on rear door PN: DA4-9052-00-11.
- 22. Installed new Concorde battery PN: RG24-15M.
- 23 Replaced multiple frayed bonding straps as needed on ailerons and flap pushrods.
- 24. Reglued rear window with new dam tape and diamond window sealant.
- 25. Made small patch on forward RH baffle.
- 26. Installed new wing root seal on both wings PN: DAI-9057-00-01.
- Removed all existing Amsafe seat belt hardware and accessories, old Pilot and Copilot seat belts PN: 509871-401-8168.. Removed Pilot inflator 27. PN: 508792-401, removed Copilot inflator PN: 508792-40, removed pilot and copilot seat belt latches PN: 7053-203. Amsafe system is removed see 337 for documentation and an update has been made to weight and balance.
- 28. Installed new seat belt latches Pilot, and Copilot PN: 05-01-1C5701.
- 29. Installed new Prop cable PN: DAI-9076-00-03.
- 30. Removed power flow exhaust and performed ICA's and Installed with new exhaust gaskets PN: LW19296, hardware, and neoprene strap.
- 31. Performed composite repair on bottom cowling next to exhaust.
- 32. Painted top cowling and replaced all fasteners with new.
- 33. Applied fire retardant paint to battery box, and top and bottom cowlings Item no.HENSOTHER2KS.
- 34. Installed interior seats with newly recovered upholstery, see burn certs from fiber new W/O: 1425.
- 35. Painted rudder below static wick due to maintenance induced surface level scratch.
- 36. Removed surface corrosion on engine mount next to #4 exhaust riser, primed and painted.
- 37. Installed new ground placard next to RH and LH step.
- 38. Applied touch up paint to various parts of leading edges of wings.
- 39. Performed weld repairs on RH wing middle fuel tank, leak checked and confirmed to not be leaking at time of repair.
- 40. Installed new engine SCAT tubing.
- 41. Performed fiberglass repair next to RH step and LH, crack was determined to only be in filler material. Crack was sanded down filled and painted.
- 42. Installed two new static wicks on LH wing tip, LH horizontal and RH horizontal PN: 16630.
- 43. Installed new induction filter PN: FR-08504.
- 44 Sealed and contoured LH aileron trailing edge with carbon fiber flox and resin. 45.
- Installed new bolts on elevator trim cover PN: LN9037-M4X16, DIN985-M4-A2
- 46. Installed two new EGT probes on #1 and #3 cylinders PN: A002BG-WIP.
- 47. Installed new emergency battery PN: DA4-2560-91-00.
- 48. Installed new RH arm rest PN: DA4-5210-50-92.
- 49 Installed new LH arm rest PN: DA4-5210-50-91
- 50. Installed new prop governor bolt PN: D41-6126-00-30.
- 51. Installed new decals from aero graphics W/O: 161261.
- Resealed Pilot LH brake master cylinder reseal Kit PN: 199-516. 52.
- 53. Replaced all G1000 knobs with new.
- 54. Performed composite repair on top cowling rear fastener.
- 55. Installed new chafe tape on vertical stab.
- Removed and primed and painted aileron ground tab. 56.
- Reglued right side jack pad. 57.

Performed ground test and flight test, no defects noted for the work performed.

This aircraft, airframe, engine, propeller, or appliance identified was repaired and/or inspected in accordance with the current regulations of the Federal Aviation Administration and is approved for return to service for the work performed.

Airframe Logbook Date: 10/14/2025

Ai	Mar	4
AIRGRAFT	SALES & BROKER	AGE

Reg No: N654MS	Aircraft type: Diamond DA40	Aircraft S/N: 40.842
Tach: 3502.5	Hobbs: 4828.5	Aircraft Total Time: 3502.5
Engine Total Time: 1734.2	Engine SMOH: N/A	Engine S/N: RL3841-51E
Prop Total Time: 1634.7	Prop SMOH: N/A	Prop S/N: NS1647B

- I certify that this aircraft has been inspected in accordance with an Annual Inspection and found to be in airworthy
 condition. Inspection performed in accordance with FAR 43 appendix D, using the Diamond DA-40 Maintenance
 Manual inspection guide as a reference.
- 2. New 406 ELT installed, ELT tested in accordance with 14 CFR 91.207, ops checked OK, ELT BATT EXPIRATION: 08/2030
- 3. Aircraft lubricated in accordance with AMM lube chart, lubricated the following items, brake pedal pivot, rudder cable S-tubes, flap extension rod, passenger door safety button, upper rudder pivot bearing, wing main bolts lubed with AERO 22 before install, elastomer eye was lubed, battery terminal ends lubed, B bolts and bearing, A bolts and bearings, brake pedal pivot shaft, flap actuator, brake caliper locating pins, stick support pivot pins, cable eyes on rudder, gascolator screen checked, no abnormalities noted.
- 4. Weight and balance updated to reflect removal of AMSAFE seat restraints STC for pilot and co-pilot seat, (see 337) and previously removed wheel pants which were not shown in any weight and balance corrections.
- 5. AD's checked through this date, all applicable have been complied with.
- 6. Complied with AD 2024-21-02 by visual inspection of oil filter and screens at annual oil change in accordance with Lycoming MSB 480F, no bronze colored metal or abnormalities noted. Effected parts are installed, NEXT DUE: at next oil change.
- Complied with AD 15-19-07 fuel injector by visual inspection, next due after any maintenance is done involving
 fuel injector clamp is disconnected, moved, or loosened and within every 110 hours TIS, (TACH: 3612.50) and after
 each engine overhaul.

This aircraft, airframe, engine, propeller, or appliance identified was repaired and/or inspected in accordance with the current regulations of the Federal Aviation Administration and is approved for return to service for the work performed.

Date:	19/14/2025	Signed:	pro Car	
7.0		-	Robert Crawford AP/IA 3895252	

THOROUGHBRED THOROUGHBRED

THOROUGHBRED AVIATION MAINTENANCE, INC. 4316 HANGAR DRIVE LEXINGTON, KY 40510 CRS#R81R199Y

SYSTEM TEST DATE: 10-14-25 WORK ORDER: A25209TACH: ------ HOBBS: 4831.0

AIRCRAFT REG# N654MS AIRCRAFT SERIAL NUMBER: 40.842

AIRCRAFT MAKE/MODEL: DIAMOND AIRCRAFT DA 40

I HEREBY CERTIFY THAT THE ALTIMETER, ENCODER, AND STATIC SYSTEM TESTS/INSPECTIONS REQUIRED BY 14 CFR §91.411 HAVE BEEN PERFORMED AND MEET SPECIFICATIONS SET FORTH IN 14 CFR 43 APPENDIX E.

ADC TESTED TO 20,000 FEET STBY ALTIMETER TESTED TO 20,000 FEET

I HEREBY CERTIFY THAT THE ATC TRANSPONDER TEST/INSPECTION REQUIRED BY 14 CFR §91.413 WAS PERFORMED AND FOUND TO COMPLY WITH FAR 43, APPENDIX F.

#1 TRANSPONDER MAKE: GARMIN MODEL NUMBER: GTX 33 SERIAL NUMBER: 89105006

TESTED BY:

Cert# 4136889

Form TAM021-03/24