

HARTZELL

N 2011T

PROPELLER LOGBOOK

AirMart.com

AIRCRAFT SALES & BROKERAGE

PROPELLER MODEL PHC-J34F-1RF/F7693DF-2

PROPELLER S/N FP8700B

LOGBOOK # 1

Model Number PHC-J3YF-1RF/F7693DF-2											
Ass'y Ser No. FP8700B		Hydr Unit No. NA		Bulkhead No. NA			Valve No. NA				
Blade 1:L63397		Blade 2:L63398		Blade 3:L63399		Blade 4:		Blade 5:		Blade 6:	
Clamp 1:		Clamp 2:		Clamp 3:		Clamp 4:		Clamp 5:			
Reverse NA	Start Lock NA	Low Pitch 16.5	High Pitch 38.0	Feather NA	Position 3	Orient. L	Qty:Al 0	St 0	Scrw 2	A-2424-1 0	Washer 0
Ref Radius (inches) for angles: 30											
Comments: Deice Kit: NA											
Packing Certified By:				Date:							
Inspected By: MIKEH											

The approved design data for this propeller incorporates all changes required by applicable Airworthiness Directives.
The propeller covered by this certificate has passed a functional test as required by 14 CFR Part 21.137(e)(2).



PROPELLER MAINTENANCE RECORD

Position _____

PITCH RANGE

Propeller Model PHC-J3YF-1RF/F7693DF-2

High/Feather _____

Propeller S/N FP8700B

Start Lock _____

Blade Design _____

Low _____

Blade S/N's

Reverse _____

No. 1 L63397

No. 2 L63398

Aircraft Manufacturer MOONEY INT'L CORP.

No. 3 L63399

Aircraft Model M20R

No. 4 _____

S/N 29-0524

No. 5 _____

Registration N2011T


No. 6 _____

Spinner Assembly Part No. A-2295-10P


Date	Propeller TSN TSO	A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
			Mooney International Corporation Repair Station CRS# 8MBR609C 165 Al Mooney Road, North Kerrville, TX 78028 N2011T M/N M20R S/N 29-0524 Hobbs Time: 12.0
			IAW STC SA02193CH adjusted propeller pitch stops for 2700 RPM. Adjustment was made per the Hartzell 115N manual. Ground check good. The aircraft, airframe, aircraft engine, propeller, or appliance identified above was repaired and inspected in accordance with current Regulations of the Federal Aviation Agency and is approved for return to service. Pertinent details of the repair are on file at this repair station under Order No. 0059.
			Signature <u>Stacey Ellis</u> Mooney International Corporation
			CRS# 8MBR609C Date <u>12/06/2016</u>





	PROP MODEL: PHC-JSYF-1RF/F7693DF-2 PROP S/N: FP8700B REG NO: N2011T WORK ORDER: 2668-11-2017	Don Maxwell Aviation Services, Inc. 390 Central Road Longview, Tx 75603 Phone: 903-643-9902	DATE: 12/01/2017 A/C TSN: 108.6 PROP TT: 108.6 TSPCH: 108.6 TACH: 108.6
	Prop Entries		
	(6) Check prop for nicks and abrasion. Remove spinner, check for cracks. Check hub & blades for leakage & security. Reinstall spinner.		
	I certify this prop has been inspected in accordance with a 100 hr inspection and found in an airworthy condition. Don Maxwell A&P1784050		
	DATE: 12/21/2017	SIGNED: <u>Don Maxwell</u>	Work Order: 2668-11-2017
			Printed by EBis 3 (datcomedia.com)
	PROP MODEL: PHC-JSYF-1RF/F7693DF-2 PROP S/N: FP8700B REG NO: N2011T WORK ORDER: 2879-12-2018	Don Maxwell Aviation Services, Inc. 390 Central Road Longview, Tx 75603 Phone: 903-643-9902	DATE: 1/2/2019 A/C TSN: 136.6 PROP TT: 136.6 TSPCH: 136.6 TACH: 136.6
	Prop Entries		
	(6) Check prop for nicks and abrasion. Remove spinner, check for cracks. Check hub & blades for leakage & security. Reinstall spinner.		
	I certify this prop has been inspected in accordance with a 100 hr inspection and found in an airworthy condition. Don Maxwell A&P1784050		
	DATE: 1/2/2019	SIGNED: <u>Don Maxwell</u>	Work Order: 2879-12-2018
			Printed by EBis 3 (datcomedia.com)



Date	Propeller		A/C	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO	Hrs	
	N2011T Mooney M20R s/n 29-0524 tach 171.5			
			5410 OPERATIONS ROAD, MONROE, LA 71203	DATE <u>6-18-19</u>
	(318) 387-0236			
	<p>Reinstalled Prop after repair by Byam Propeller Service CRS #WN1R590K work order 40293. Prop PHC-J3Y-1RF s/n FP8700B. Installed accordance with Mooney and Continental maintenance Manual. Performed crank run out inspection in accordance with Continental Maintenance Manual. Ops check good with no leaks.</p>			
	<p>The aircraft, airframe, aircraft engine, propeller or appliance identified above was repaired and inspected in accordance with current regulations of the FAA and is approved for return to service.</p>			
	JPS AVIATION LLC, REGIONAL AIRPORT, MONROE LA			
	SIGNED <u>Thomas B Gles</u>		WO#	<u>15061</u>
	A&P <u>3248894</u>			

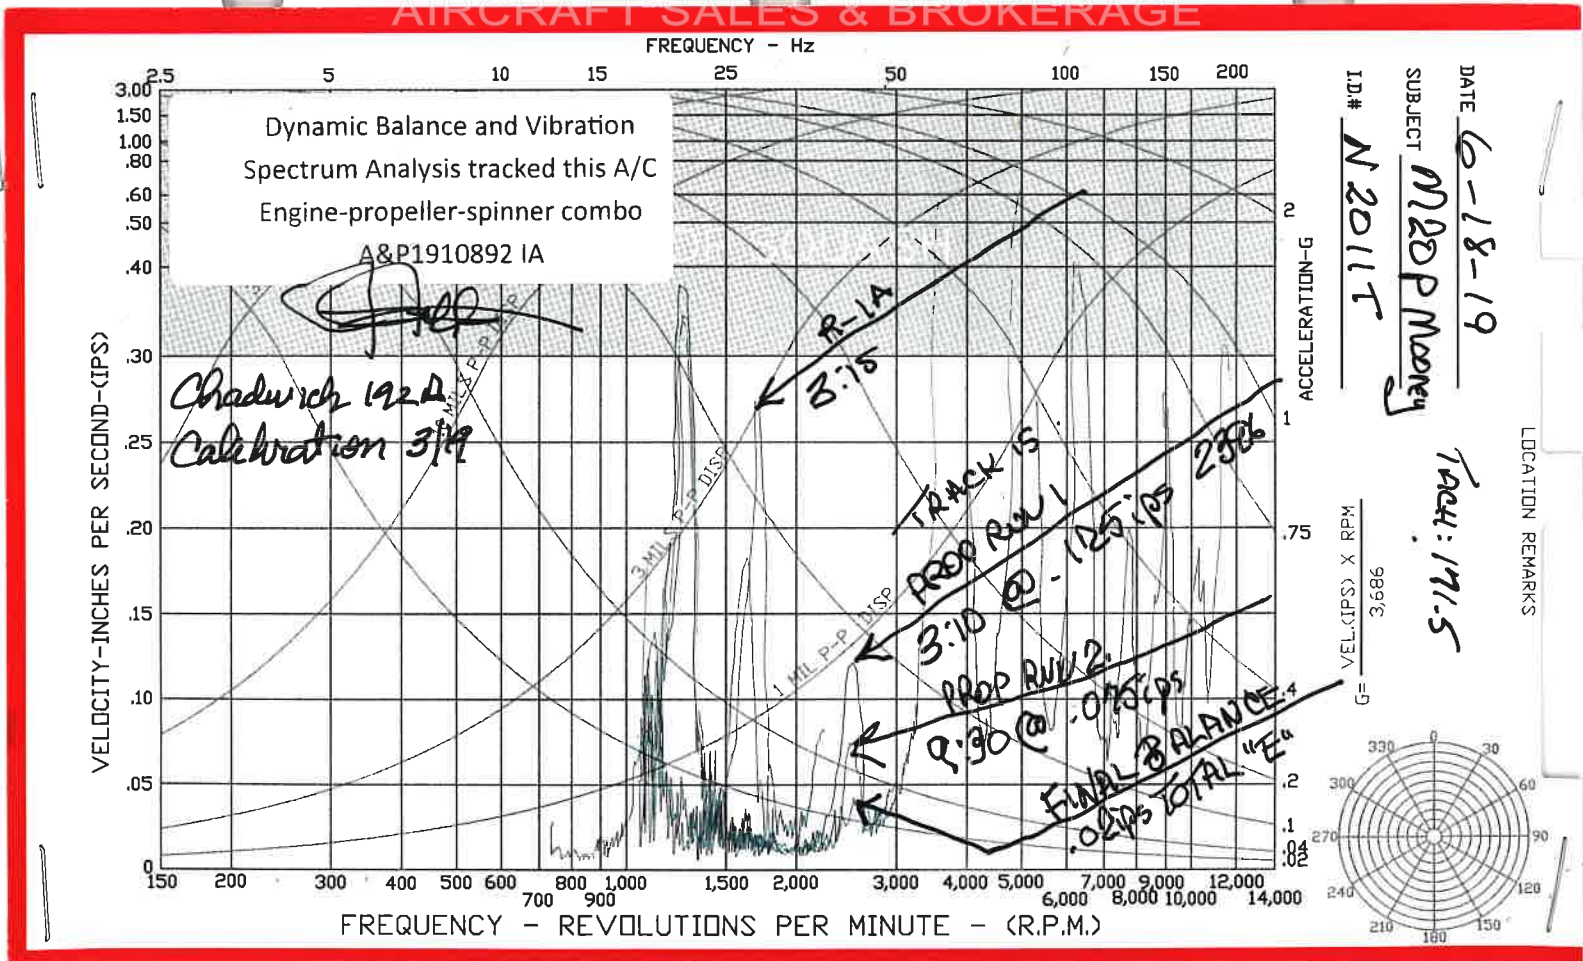AirMart.com
AIRCRAFT SALES & BROKERAGE



Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.
	TSN	TSO		
				<p>EPPS Aviation </p> <p>AIRCRAFT REG: N2011T DATE: 14-Oct-2019 MFG: MOONEY WORK PACKAGE: P7441 MODEL: M20R TACH TIME: 218.7 SERIAL: 29-0524 TOTAL TIME: 218.7 HOUR METER: N/A CYCLES/LANDINGS: N/A</p> <p>Removed cowling and washed engine. Ran engine to normal operating temperatures and actuated propeller governor. Inspected engine and discovered propeller governor leaking. Removed old propeller governor P/N: C290D8/T1 S/N: 150163 and installed new governor P/N: C290D3R/T20 S/N: 071009 with new gasket P/N: B-20024. Ground ran aircraft and found no discrepancies.</p> <p>The aircraft, airframe, engine, propeller or appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is approved for return to service. Pertinent details of the repair are on file at this repair station under work package no. P7441.</p> <p>Signed:  SETH MARTIN for Epps Air Service, Inc., ESMR688D, 1 Aviation Way, Atlanta, GA 30341</p> <p style="text-align: right;">Page 1 of 1</p>

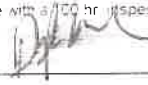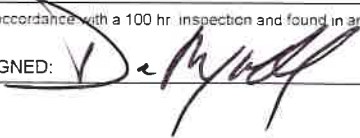

<p>PROP MODEL: PHC-J3YF-1RF/F7693DF-2 PROP S/N: FP8700B REG NO: N2011T WORK ORDER: 3111-12-2019</p> <p>Don Maxwell Aviation Services, Inc. 390 Central Road Longview, Tx 75603 Phone: 903-643-9902</p> <p>DATE: 12/20/2019 A/C TSN: 243.4 PROP TT: 243.4 TSPCH: 243.4 TACH: 243.4</p> <p>Prop Entries (6) Check prop for nicks and abrasion. Remove spinner, check for cracks. Check hub & blades for leakage & security. Reinstall spinner.</p> <p>I certify this prop has been inspected in accordance with a 100 hr inspection and found in an airworthy condition Don Maxwell A&P1734050</p> <p>DATE: 12/20/2019 SIGNED:  Work Order: 3111-12-2019 Printed by EBis 3 (datcomedia.com)</p>
<p>PROP MODEL: PHC-J3YF-1RF/F7693DF-2 PROP S/N: FP8700B REG NO: N2011T WORK ORDER: 3308-10-2020</p> <p>Don Maxwell Aviation Services, Inc. 390 Central Road Longview, Tx 75603 Phone: 903-643-9902</p> <p>DATE: 10/20/2020 A/C TSN: 373.9 PROP TT: 373.9 TSPCH: 373.9 TACH: 373.9</p> <p>Prop Entries (6) Check prop for nicks and abrasion. Remove spinner, check for cracks. Check hub & blades for leakage & security. Reinstall spinner.</p> <p>I certify this prop has been inspected in accordance with a 100 hr inspection and found in an airworthy condition Don Maxwell A&P1784050</p> <p>DATE: 10/20/2020 SIGNED:  Work Order: 3308-10-2020 Printed by EBis 3 (datcomedia.com)</p>