

PROPELLER MAINTENANCE RECORD

Position L.H.

PITCH RANGE

Propeller Model HC-EYN 3N

High/Feather _____

Propeller S/N HH2763

Start Lock _____

Blade Design DS990SK

Low _____

Blade S/N's

Reverse _____

No. 1 K50313

No. 2 K50321

No. 3 K50314

No. 4 K50320

No. 5 _____

No. 6 _____



Aircraft Manufacturer _____

Aircraft Model _____

S/N _____

Registration _____

Spinner Assembly Part No. _____

Date	Propeller		A/C Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.																
	TSN	TSO																		
1-16-07	0	0	0	Installed on LJ-1817 L.H. 																
				EUGENE HAINSTOCK FOR RAYTHEON AIRCRAFT CO.																
				<input type="checkbox"/> RONSON AVIATION, INC <input type="checkbox"/> CRS EHR538D <input type="checkbox"/> TRENTON-MERCER AIRPORT <input type="checkbox"/> TRENTON, NJ 08628 (609) 771-9500 FAX (609) 771-0651																
				<table border="1"> <tr> <td>REG #</td> <td>N610SC</td> <td>DATE:</td> <td>11/5/2007</td> </tr> <tr> <td>MAKE:</td> <td>HARTZELL</td> <td>W/O #:</td> <td>24050</td> </tr> <tr> <td>MODEL:</td> <td>HC-E4N-3</td> <td>HM:</td> <td>196.4</td> </tr> <tr> <td>S/N:</td> <td>HH-2763</td> <td>TT:</td> <td>196.4</td> </tr> </table>	REG #	N610SC	DATE:	11/5/2007	MAKE:	HARTZELL	W/O #:	24050	MODEL:	HC-E4N-3	HM:	196.4	S/N:	HH-2763	TT:	196.4
REG #	N610SC	DATE:	11/5/2007																	
MAKE:	HARTZELL	W/O #:	24050																	
MODEL:	HC-E4N-3	HM:	196.4																	
S/N:	HH-2763	TT:	196.4																	
				LEFT PROPELLER LOG																
				1. C/W FAR 91.409(f)(3) BY PERFORMING PHASE 1&2 INSPECTION AS PER BEECH C90GT M/M INSPECTION FORM FOUND IN CHAPTER 5. 2. DRESS AND LUBRICATED HUB.																
				MAINTENANCE RELEASE																
				I certify that this aircraft has been inspected in accordance with a PHASE 1&2 and was inspected and approved for return to service. Pertinent details of the inspection are on file at this agency under the work number shown above. I certify that the article described above has been inspected and approved for return to service.																
				Signed  for RONSON AVIATION, INC. <input type="checkbox"/> CRS EHR538D RONSON AVIATION, INC CRS EHR538D TRENTON-MERCER AIRPORT TRENTON, NJ 08628 (609) 771-9500 FAX (609) 771-0651																

10/14/09	TT 418.2	TLDO5 299.	
			PERFORMED A PHASE 3 & 4 INSPECTION
			IAW BEOCA C90CT MAINT MANUAL
			DRESSED & PAINTED BLADES AS REQUIRED.
			LUBRICATED PROPELLER WITH AEROSHELL #6
			<i>[Signature]</i> 110784446.09



STEVENS AVIATION INC.
NASHVILLE, TN

October 29, 2009

Left Prop S/N HH-2763

N610SC
S/N LJ-1817
TSN 740.6

ACTT 740.6
HM 740.6


Dressed Blades, Painted Tips & Faces. Lubricated Propeller. Adjusted blade angle.

I certify this *Propeller* has been inspected in accordance with FAR 91.409(F) 3 and a *HB Complete* Inspection was accomplished and the aircraft is approved for return to service. Pertinent details are on file at this agency under work order number 1490.

SIGNED

[Signature]

For STEVENS AVIATION, Nashville, TN 37217, CRS VIB3368K

N610SC
S/N LJ-1817
TSN 864.8ACTT 864.8
HM 864.8


August 11, 2010

Left Prop S/N HH-2763

All maintenance performed in accordance with applicable sections of manufactures maintenance manual. Removed and reinstalled propeller to facilitate changing the propeller shaft seal.

The Maintenance Identified Above Has Been Inspected And The Item Is Approved For Return To Service. Pertinent Details Of The Repair Are On File At This Agency Under Work Order Number 2253.

Signed *Ch...*
For STEVENS AVIATION Nashville, TN 37217 CRS VIB3368K

N610SC
S/N LJ-1817
TSN 876.7ACTT 876.7
HM 876.7

November 4, 2010

Left Prop S/N HH-2763


Dressed Blades, Painted Tips & Faces. Lubricated Propeller.

I certify this *Propeller* has been inspected in accordance with FAR 91.409(F) 3 and a *HB Phase 1 & 2* Inspection was accomplished and the aircraft is approved for return to service. Pertinent details are on file at this agency under work order number 2449.

SIGNED *Ch...*
For STEVENS AVIATION, Nashville, TN 37217, CRS VIB3368K

18592230222

5



STEVENS AVIATION INC.
NASHVILLE, TN

N610SC
S/N LJ-1817
TSN 987.9

ACTT 987.9
HM 987.9

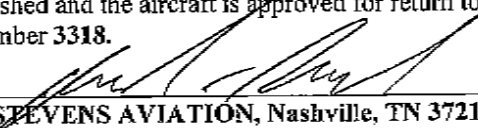
October 25, 2011


Left Prop S/N HH2763

Dressed Blades. Lubricated Propeller.

I certify this *Propeller* has been inspected in accordance with FAR 91.409(F) 3 and a *HB Phase 3 & 4* Inspection was accomplished and the aircraft is approved for return to service. Pertinent details are on file at this agency under work order number 3318.

SIGNED


For STEVENS AVIATION, Nashville, TN 37217, CRS VIB3368K



STEVENS AVIATION INC.
NASHVILLE, TN

N610SC
S/N LJ-1817
TSN 1130.3

ACTT 1130.3
HM 1130.3

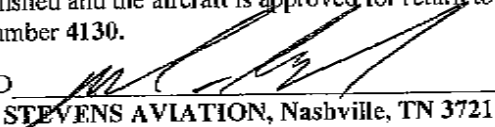
November 7, 2012

Left Prop S/N HH2763

Dressed Blades. Lubricated Propeller.

I certify this *Propeller* has been inspected in accordance with FAR 91.409(F) 3 and a *HB Phase 1 & 2* Inspection was accomplished and the aircraft is approved for return to service. Pertinent details are on file at this agency under work order number 4130.

SIGNED


For STEVENS AVIATION, Nashville, TN 37217, CRS VIB3368K



STEVENS AVIATION, INC.
NASHVILLE, TN

N610SC
S/N LJ-1817
TSN 1220.0

ACTT 1220.0
HM 1220.0

November 5, 2013

Left Prop S/N HH2763

Removed serviceable propeller and sent out for overhaul.

Pertinent Details on File at This Agency under Work Order Number 4906

Signed

[Signature]
For STEVENS AVIATION Nashville, Tn 37217 CRS VIB3368K

THIS PROPELLER/~~COMPONENT~~ HAS
BEEN OVERHAULED/~~REPAIRED~~ AS
PER MAINTENANCE RELEASE TAG
UNDER WORK ORDER NO. 20132
DATED 11/11/2013


FOR: HC-E4N-3N S/N HH2763
MEMPHIS PROPELLER SERVICE, INC.
OLIVE BRANCH, MISSISSIPPI
FAA C.R.S. # PI4B441M

BY:

Trong Vu, Chief Inspector

18592230222

7 / 9



STEVENS AVIATION, INC.

NASHVILLE, TN

November 13, 2013

Left Prop S/N HH2763

N610SC

S/N LJ-1817

TSN 1220.0

ACTT 1220.0


HM 1220.0

TSO 0.0


Reinstalled propeller after 72 mth/4000 hr Overhaul by Memphis Propeller Service Inc. CRS# PI4R441M.
Dynamically balanced propeller to below .1 ips using Dynamic Solutions System Inc. Microvib II Aircraft Analyzer.
Work performed IAW Microvib II and Hawker Beech Maintenance Manual Chapter 61.

Pertinent Details on File at This Agency under Work Order Number 4906.

Signed


For STEVENS AVIATION Nashville, Tn 37217 CRS VIB3368K

9/30/2007

1. Approving National Aviation Authority / Country: FAA/UNITED STATES		2. AUTHORIZED RELEASE CERTIFICATE FAA Form 8130-3, AIRWORTHINESS APPROVAL TAG				3. Form Tracking Number: 111113	
4. Organization Name and Address: MEMPHIS PROPELLER SERVICE, INC. P14R441M 11098 Willow Ridge Drive - Olive Branch, Mississippi, 38554				5. Work Order/Contract/ Invoice Number: 20132			
6. Item	7. Description	8. Part Number	9. Eligibility *	10. Quantity	11. Serial / Batch Number	12. Status / Work:	
1	Propeller	HC-E4N-3N	NA	1	HH2763	Overhauled	
13. Remarks: Overhauled Propeller Assembly in accordance with FAA Approved Data. Full Details of Work Carried Out Per Work Order 20132. TSN: 1220.0 TSO: 0.0 Blade Model: D8990SK S/N: K50313, K50321, K50314, K50320							
14. Certifies the items identified above were manufactured in conformity to: <input type="checkbox"/> Approved design data and are in a condition for safe operation. <input type="checkbox"/> Non-approved design data specified in Block 13.				19. <input checked="" type="checkbox"/> 14 CFR 43.9 Return to Service <input type="checkbox"/> Other regulation specified in Block 13 Certifies that unless otherwise specified in Block 13, the work identified in Block 12 and described in Block 13 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service.			
15. Authorized Signature		16. Approval / Authorization No.:		20. Authorized Signature:		24. Approval / Certificate No.:	
						CRS P14R441M	
17. Name (Typed or Printed):		18. Date (m/d/yy): 00/00/00		22. Name (Typed or Printed): Trong Vu		23. Date (m/d/yy): Nov 11, 2013	